



100 NW Business Park Lane  
Riverside, MO 64150  
Telephone: 816.231.5580  
Fax: 816.231.5641  
[www.occutec.com](http://www.occutec.com)

September 27, 2017

Diane Czarnecki  
Industrial Hygienist  
Facilities Management Division  
GSA Public Buildings Service - Heartland Region  
U.S. General Services Administration  
2300 Main Street, Kansas City, MO 64108

**RE: Goodfellow Federal Center  
Metals in Settled Dust Sampling in Electrical Vaults  
4300 Goodfellow Boulevard  
St. Louis, Missouri 63120  
OCCU-TEC Project No. 917004.002**

Dear Ms. Czarnecki:

Thank you for the opportunity to assist the General Services Administration (GSA) with the metals in settled dust sampling investigation of the electrical vaults located at the Goodfellow Federal Center (GFC), in St. Louis, Missouri. OCCU-TEC understands that the purpose of the investigation was to provide additional sampling data regarding existing environmental conditions that are present at GFC that could adversely impact construction activities and maintenance workers at the facility. The following report summarizes the sample collection activities and the laboratory analytical results of samples submitted.

On September 7, 2017, a team of OCCU-TEC personnel including a Missouri licensed lead risk assessor conducted settled dust sampling for the presence of seven of the Resource Conservation and Recovery Act (RCRA) target metals (lead, arsenic, barium, cadmium, chromium, selenium, and silver) from various surfaces within the electrical vaults at representative locations throughout GFC. These sampling activities were conducted at the following buildings: 103, 103F, 104, 105, 107, 108A, 108B, and 110. The purpose of this testing was to determine the presence and concentration of these target metals in settled dust within the electrical vaults on both existing equipment surfaces as well as concrete floors.

The proposed sampling scheme, the number of samples, the sample distribution and general methodology was developed by GSA and OCCU-TEC. Specific sample locations were determined by OCCU-TEC field personnel on-site.

### ***Metals in Settled Dust Sampling***

Metals in settled dust sampling was completed from various surfaces within the vaults utilizing lead dust wipe sampling methodology.

Dust wipe sampling was conducted in accordance with ASTM Standard E1728-16: Standard Practice for Collection of Settled Dust Samples Using Wipe Sampling Methods for Subsequent Lead Determination. ASTM Standard E1728-16 is consistent with the methodology described in the Housing and Urban Development Guidelines and 40 CFR 745.63. The Brookhaven National Laboratory's Surface Wipe Sampling Procedure (IH75190) was also used as a guideline.

Dust wipe sampling for the target metals was conducted on a variety of representative surfaces that have the potential of being disturbed during planned maintenance or renovation projects within the electrical vaults. A representative surface area of approximately one square foot (1 SF) was measured and delineated with pre-fabricated, disposable templates. The dust wipe samples were collected using dedicated dust wipe cloths meeting ASTM standards. Each dust wipe cloth was pre-moistened and individually wrapped. Each sample was collected by wiping in a back and forth "S" pattern over a measured sampling area of approximately 1 SF. Then, the wipe was folded over itself and the area was wiped again in a direction perpendicular to the first wipe orientation. The wipe samples were then placed into labeled, clean laboratory-supplied plastic centrifuge tubes with screw on caps. Dust wipe samples were submitted to Sanair Technologies Laboratory Inc. (Sanair) in Powhatan, Virginia for Inductively Coupled Plasma (ICP) total analysis of metals analysis according to Environmental Protection Agency (EPA) method SW846 350B/7420.

Results of the dust wipe samples collected from the electrical vaults indicate that all the 72 samples contained concentrations of target metals above laboratory detection limits. The following table identifies the range of results for each of the seven metals that were sampled. **Samples with a "<" sign indicate that the results were below the reportable limit.**

Goodfellow Federal Center  
Metals in Settled Dust Sampling in  
Electrical Vaults

Analysis	Lowest Concentration ( $\mu\text{g}/\text{sq. ft.}$ )	Highest Concentration ( $\mu\text{g}/\text{sq. ft.}$ )
Silver	<2.50	8.80
Arsenic	<2.50	20.7
Barium	3.24	740.00
Cadmium	<2.50	105.00
Total Chromium	<2.50	330.00
Lead	<2.50	10,370.00
Selenium	<2.50	36.50

Many of the samples collected contained target metals above the regulatory or recommended levels. Based on the results of the sampling, all the electrical vaults should be presumed to contain measurable levels of RCRA metals and proper precautions should be taken upon entry and exit of the vaults to protect workers and limit the spread of dust to the outside environment.

OCCU-TEC appreciates the opportunity to work with GSA on this project. If you have any questions concerning this report, or if we may be of any additional service, please feel free to contact us.

Sincerely,

(b) (6)

Jeff T. Smith  
Senior Project Manager

(b) (6)

Jay Hurst  
Director of Operations (QA/QC)

Appendices:

- A - Sample Summary Table
- B – Sample Location Maps
- C - Laboratory Analysis Reports
- D - Licenses

# **Appendix**

## **A**

### Sample Summary Table

**Goodfellow Federal Center - Electrical Vault Wipe Sample Data**

Sample Number	Location	Area Description	Analyte	Result	Units	Recommended Limit (*)
103-1-1	Building 103 Electrical Vault 1	Upper Level - Electrical Vault Floor	Silver	< 2.50	µg/ft <sup>2</sup>	139/9.3
			Arsenic	< 2.50	µg/ft <sup>2</sup>	139/9.3
			Barium	270.00	µg/ft <sup>2</sup>	
			Cadmium	5.70	µg/ft <sup>2</sup>	27.9/1.9
			Chromium	28.00	µg/ft <sup>2</sup>	
			Lead	234.00	µg/ft <sup>2</sup>	250/40
			Selenium	< 2.50	µg/ft <sup>2</sup>	
103-1-2	Building 103 Electrical Vault 1	Upper Level - Top of Cabinet	Silver	< 2.50	µg/ft <sup>2</sup>	139/9.3
			Arsenic	< 2.50	µg/ft <sup>2</sup>	139/9.3
			Barium	68.00	µg/ft <sup>2</sup>	
			Cadmium	5.48	µg/ft <sup>2</sup>	27.9/1.9
			Chromium	5.20	µg/ft <sup>2</sup>	
			Lead	183.00	µg/ft <sup>2</sup>	250/40
			Selenium	< 2.50	µg/ft <sup>2</sup>	
103-1-3	Building 103 Electrical Vault 1	Vault Floor - Lower Level	Silver	5.20	µg/ft <sup>2</sup>	139/9.3
			Arsenic	11.30	µg/ft <sup>2</sup>	139/9.3
			Barium	243.00	µg/ft <sup>2</sup>	
			Cadmium	9.60	µg/ft <sup>2</sup>	27.9/1.9
			Chromium	54.40	µg/ft <sup>2</sup>	
			Lead	609.00	µg/ft <sup>2</sup>	250/40
			Selenium	12.80	µg/ft <sup>2</sup>	
103-1-4	Building 103 Electrical Vault 1	Cabinet Lower Level	Silver	< 2.50	µg/ft <sup>2</sup>	139/9.3
			Arsenic	< 2.50	µg/ft <sup>2</sup>	139/9.3
			Barium	182.00	µg/ft <sup>2</sup>	
			Cadmium	10.60	µg/ft <sup>2</sup>	27.9/1.9
			Chromium	18.50	µg/ft <sup>2</sup>	
			Lead	477.00	µg/ft <sup>2</sup>	250/40
			Selenium	2.69	µg/ft <sup>2</sup>	
103-2-1	Building 103 Electrical Vault 2	Electrical Vault Floor Concrete - Upper Level	Silver	< 2.50	µg/ft <sup>2</sup>	139/9.3
			Arsenic	< 2.50	µg/ft <sup>2</sup>	139/9.3
			Barium	71.00	µg/ft <sup>2</sup>	
			Cadmium	< 2.50	µg/ft <sup>2</sup>	27.9/1.9
			Chromium	8.05	µg/ft <sup>2</sup>	
			Lead	60.30	µg/ft <sup>2</sup>	250/40
			Selenium	< 2.50	µg/ft <sup>2</sup>	
103-2-2	Building 103 Electrical Vault 2	Switch Board #506349 - Upper Level	Silver	< 2.50	µg/ft <sup>2</sup>	139/9.3
			Arsenic	< 2.50	µg/ft <sup>2</sup>	139/9.3
			Barium	213.00	µg/ft <sup>2</sup>	
			Cadmium	13.70	µg/ft <sup>2</sup>	27.9/1.9
			Chromium	20.10	µg/ft <sup>2</sup>	
			Lead	1690.00	µg/ft <sup>2</sup>	250/40
			Selenium	4.90	µg/ft <sup>2</sup>	

Sample Number	Location	Area Description	Analyte	Result	Units	Recommended Limit (*)
103-2-3	Building 103 Electrical Vault 2	Electrical Vault Floor Concrete - Lower Level	Silver	2.60	µg/ft <sup>2</sup>	139/9.3
			Arsenic	< 2.50	µg/ft <sup>2</sup>	139/9.3
			Barium	160.00	µg/ft <sup>2</sup>	
			Cadmium	4.30	µg/ft <sup>2</sup>	27.9/1.9
			Chromium	27.10	µg/ft <sup>2</sup>	
			Lead	116.00	µg/ft <sup>2</sup>	250/40
			Selenium	4.37	µg/ft <sup>2</sup>	
103-2-4	Building 103 Electrical Vault 2	Switch Gear (Face) - Lower level	Silver	< 2.50	µg/ft <sup>2</sup>	139/9.3
			Arsenic	< 2.50	µg/ft <sup>2</sup>	139/9.3
			Barium	11.60	µg/ft <sup>2</sup>	
			Cadmium	< 2.50	µg/ft <sup>2</sup>	27.9/1.9
			Chromium	< 2.50	µg/ft <sup>2</sup>	
			Lead	12.10	µg/ft <sup>2</sup>	250/40
			Selenium	< 2.50	µg/ft <sup>2</sup>	
103-3-1	Building 103 Electrical Vault 3	Top of Duct SW Side - Upper Level	Silver	< 2.50	µg/ft <sup>2</sup>	139/9.3
			Arsenic	< 2.50	µg/ft <sup>2</sup>	139/9.3
			Barium	330.00	µg/ft <sup>2</sup>	
			Cadmium	17.60	µg/ft <sup>2</sup>	27.9/1.9
			Chromium	23.40	µg/ft <sup>2</sup>	
			Lead	203.00	µg/ft <sup>2</sup>	250/40
			Selenium	4.80	µg/ft <sup>2</sup>	
103-3-2	Building 103 Electrical Vault 3	Electrical Vault Floor - Lower Level	Silver	< 2.50	µg/ft <sup>2</sup>	139/9.3
			Arsenic	< 2.50	µg/ft <sup>2</sup>	139/9.3
			Barium	108.00	µg/ft <sup>2</sup>	
			Cadmium	5.90	µg/ft <sup>2</sup>	27.9/1.9
			Chromium	32.30	µg/ft <sup>2</sup>	
			Lead	145.00	µg/ft <sup>2</sup>	250/40
			Selenium	4.80	µg/ft <sup>2</sup>	
103-3-3	Building 103 Electrical Vault 3	Transformer #508900 - Lower Level	Silver	< 2.50	µg/ft <sup>2</sup>	139/9.3
			Arsenic	< 2.50	µg/ft <sup>2</sup>	139/9.3
			Barium	132.00	µg/ft <sup>2</sup>	
			Cadmium	5.34	µg/ft <sup>2</sup>	27.9/1.9
			Chromium	16.70	µg/ft <sup>2</sup>	
			Lead	98.00	µg/ft <sup>2</sup>	250/40
			Selenium	< 2.50	µg/ft <sup>2</sup>	
103-4-1	Building 103 Electrical Vault 4	Electrical Vault Floor Concrete - Upper Level	Silver	< 2.50	µg/ft <sup>2</sup>	139/9.3
			Arsenic	< 2.50	µg/ft <sup>2</sup>	139/9.3
			Barium	62.00	µg/ft <sup>2</sup>	
			Cadmium	3.80	µg/ft <sup>2</sup>	27.9/1.9
			Chromium	13.30	µg/ft <sup>2</sup>	
			Lead	94.30	µg/ft <sup>2</sup>	250/40
			Selenium	< 2.50	µg/ft <sup>2</sup>	

Sample Number	Location	Area Description	Analyte	Result	Units	Recommended Limit (*)
103-4-2	Building 103 Electrical Vault 4	Dry Transformer #500848	Silver	< 2.50	µg/ft <sup>2</sup>	139/9.3
			Arsenic	2.90	µg/ft <sup>2</sup>	139/9.3
			Barium	330.00	µg/ft <sup>2</sup>	
			Cadmium	23.00	µg/ft <sup>2</sup>	27.9/1.9
			Chromium	26.00	µg/ft <sup>2</sup>	
			Lead	225.00	µg/ft <sup>2</sup>	250/40
			Selenium	5.26	µg/ft <sup>2</sup>	
103-4-3	Building 103 Electrical Vault 4	Dry Transformer #500848	Silver	< 2.50	µg/ft <sup>2</sup>	139/9.3
			Arsenic	3.30	µg/ft <sup>2</sup>	139/9.3
			Barium	182.00	µg/ft <sup>2</sup>	
			Cadmium	18.00	µg/ft <sup>2</sup>	27.9/1.9
			Chromium	46.00	µg/ft <sup>2</sup>	
			Lead	360.00	µg/ft <sup>2</sup>	250/40
			Selenium	6.25	µg/ft <sup>2</sup>	
103F-1-1	Building 103F Electrical Vault 1	Top of Transformer - Lower Level	Silver	< 2.50	µg/ft <sup>2</sup>	139/9.3
			Arsenic	< 2.50	µg/ft <sup>2</sup>	139/9.3
			Barium	120.00	µg/ft <sup>2</sup>	
			Cadmium	2.64	µg/ft <sup>2</sup>	27.9/1.9
			Chromium	11.00	µg/ft <sup>2</sup>	
			Lead	63.20	µg/ft <sup>2</sup>	250/40
			Selenium	< 2.50	µg/ft <sup>2</sup>	
103F-1-2	Building 103F Electrical Vault 1	Concrete Floor - Lower Level	Silver	3.53	µg/ft <sup>2</sup>	139/9.3
			Arsenic	< 2.50	µg/ft <sup>2</sup>	139/9.3
			Barium	129.00	µg/ft <sup>2</sup>	
			Cadmium	4.80	µg/ft <sup>2</sup>	27.9/1.9
			Chromium	23.30	µg/ft <sup>2</sup>	
			Lead	445.00	µg/ft <sup>2</sup>	250/40
			Selenium	3.00	µg/ft <sup>2</sup>	
103F-1-3	Building 103F Electrical Vault 1	Transformer (Face) - Lower Level	Silver	< 2.50	µg/ft <sup>2</sup>	139/9.3
			Arsenic	< 2.50	µg/ft <sup>2</sup>	139/9.3
			Barium	8.10	µg/ft <sup>2</sup>	
			Cadmium	< 2.50	µg/ft <sup>2</sup>	27.9/1.9
			Chromium	5.56	µg/ft <sup>2</sup>	
			Lead	12.40	µg/ft <sup>2</sup>	250/40
			Selenium	< 2.50	µg/ft <sup>2</sup>	
104-1-1	Building 104 Electrical Vault 1	Metal Floor - Upper Level	Silver	< 2.50	µg/ft <sup>2</sup>	139/9.3
			Arsenic	< 2.50	µg/ft <sup>2</sup>	139/9.3
			Barium	104.00	µg/ft <sup>2</sup>	
			Cadmium	< 2.50	µg/ft <sup>2</sup>	27.9/1.9
			Chromium	10.60	µg/ft <sup>2</sup>	
			Lead	104.00	µg/ft <sup>2</sup>	250/40
			Selenium	< 2.50	µg/ft <sup>2</sup>	

Sample Number	Location	Area Description	Analyte	Result	Units	Recommended Limit (*)
104-1-2	Building 104 Electrical Vault 1	Dry Transformer - Upper Level	Silver	< 2.50	µg/ft <sup>2</sup>	139/9.3
			Arsenic	< 2.50	µg/ft <sup>2</sup>	139/9.3
			Barium	190.00	µg/ft <sup>2</sup>	
			Cadmium	< 2.50	µg/ft <sup>2</sup>	27.9/1.9
			Chromium	21.30	µg/ft <sup>2</sup>	
			Lead	125.00	µg/ft <sup>2</sup>	250/40
			Selenium	3.63	µg/ft <sup>2</sup>	
104-1-3	Building 104 Electrical Vault 1	Electrical Vault Concrete Floor - Lower Level	Silver	7.03	µg/ft <sup>2</sup>	139/9.3
			Arsenic	9.90	µg/ft <sup>2</sup>	139/9.3
			Barium	412.00	µg/ft <sup>2</sup>	
			Cadmium	45.00	µg/ft <sup>2</sup>	27.9/1.9
			Chromium	68.00	µg/ft <sup>2</sup>	
			Lead	810.00	µg/ft <sup>2</sup>	250/40
			Selenium	< 2.50	µg/ft <sup>2</sup>	
104-1-4	Building 104 Electrical Vault 1	Switchgear 4AB - Lower Level	Silver	< 2.50	µg/ft <sup>2</sup>	139/9.3
			Arsenic	< 2.50	µg/ft <sup>2</sup>	139/9.3
			Barium	115.00	µg/ft <sup>2</sup>	
			Cadmium	7.10	µg/ft <sup>2</sup>	27.9/1.9
			Chromium	17.40	µg/ft <sup>2</sup>	
			Lead	94.00	µg/ft <sup>2</sup>	250/40
			Selenium	< 2.50	µg/ft <sup>2</sup>	
104-2-1	Building 104 Electrical Vault 2	Metal Floor - Upper Level	Silver	< 2.50	µg/ft <sup>2</sup>	139/9.3
			Arsenic	< 2.50	µg/ft <sup>2</sup>	139/9.3
			Barium	97.00	µg/ft <sup>2</sup>	
			Cadmium	< 2.50	µg/ft <sup>2</sup>	27.9/1.9
			Chromium	15.20	µg/ft <sup>2</sup>	
			Lead	94.70	µg/ft <sup>2</sup>	250/40
			Selenium	3.40	µg/ft <sup>2</sup>	
104-2-2	Building 104 Electrical Vault 2	Concrete Floor - Lower Level	Silver	4.00	µg/ft <sup>2</sup>	139/9.3
			Arsenic	6.26	µg/ft <sup>2</sup>	139/9.3
			Barium	254.00	µg/ft <sup>2</sup>	
			Cadmium	5.50	µg/ft <sup>2</sup>	27.9/1.9
			Chromium	67.20	µg/ft <sup>2</sup>	
			Lead	450.00	µg/ft <sup>2</sup>	250/40
			Selenium	10.40	µg/ft <sup>2</sup>	
104-2-3	Building 104 Electrical Vault 2	Transformer - Lower Level	Silver	< 2.50	µg/ft <sup>2</sup>	139/9.3
			Arsenic	< 2.50	µg/ft <sup>2</sup>	139/9.3
			Barium	50.30	µg/ft <sup>2</sup>	
			Cadmium	< 2.50	µg/ft <sup>2</sup>	27.9/1.9
			Chromium	6.40	µg/ft <sup>2</sup>	
			Lead	70.00	µg/ft <sup>2</sup>	250/40
			Selenium	< 2.50	µg/ft <sup>2</sup>	

Sample Number	Location	Area Description	Analyte	Result	Units	Recommended Limit (*)
104-2-4	Building 104 Electrical Vault 2	Concrete Floor North Side - Lower Level	Silver	7.42	µg/ft <sup>2</sup>	139/9.3
			Arsenic	8.90	µg/ft <sup>2</sup>	139/9.3
			Barium	380.00	µg/ft <sup>2</sup>	
			Cadmium	9.14	µg/ft <sup>2</sup>	27.9/1.9
			Chromium	63.00	µg/ft <sup>2</sup>	
			Lead	256.00	µg/ft <sup>2</sup>	250/40
			Selenium	20.20	µg/ft <sup>2</sup>	
104-3-1	Building 104 Electrical Vault 3	Dry Transformer - Upper Level	Silver	5.50	µg/ft <sup>2</sup>	139/9.3
			Arsenic	< 2.50	µg/ft <sup>2</sup>	139/9.3
			Barium	190.00	µg/ft <sup>2</sup>	
			Cadmium	4.50	µg/ft <sup>2</sup>	27.9/1.9
			Chromium	25.30	µg/ft <sup>2</sup>	
			Lead	160.00	µg/ft <sup>2</sup>	250/40
			Selenium	4.60	µg/ft <sup>2</sup>	
104-3-2	Building 104 Electrical Vault 3	Concrete Floor - Lower Level	Silver	< 2.50	µg/ft <sup>2</sup>	139/9.3
			Arsenic	< 2.50	µg/ft <sup>2</sup>	139/9.3
			Barium	90.00	µg/ft <sup>2</sup>	
			Cadmium	< 2.50	µg/ft <sup>2</sup>	27.9/1.9
			Chromium	12.70	µg/ft <sup>2</sup>	
			Lead	99.50	µg/ft <sup>2</sup>	250/40
			Selenium	< 2.50	µg/ft <sup>2</sup>	
104-3-3	Building 104 Electrical Vault 3	Power Panel Board - Lower Level	Silver	< 2.50	µg/ft <sup>2</sup>	139/9.3
			Arsenic	< 2.50	µg/ft <sup>2</sup>	139/9.3
			Barium	81.10	µg/ft <sup>2</sup>	
			Cadmium	< 2.50	µg/ft <sup>2</sup>	27.9/1.9
			Chromium	31.20	µg/ft <sup>2</sup>	
			Lead	200.00	µg/ft <sup>2</sup>	250/40
			Selenium	< 2.50	µg/ft <sup>2</sup>	
104-4-1	Building 104 Electrical Vault 4	Dry Transformer - Upper Level	Silver	< 2.50	µg/ft <sup>2</sup>	139/9.3
			Arsenic	< 2.50	µg/ft <sup>2</sup>	139/9.3
			Barium	70.50	µg/ft <sup>2</sup>	
			Cadmium	93.50	µg/ft <sup>2</sup>	27.9/1.9
			Chromium	9.82	µg/ft <sup>2</sup>	
			Lead	78.60	µg/ft <sup>2</sup>	250/40
			Selenium	< 2.50	µg/ft <sup>2</sup>	
104-4-2	Building 104 Electrical Vault 4	Concrete Floor - Upper Level	Silver	< 2.50	µg/ft <sup>2</sup>	139/9.3
			Arsenic	< 2.50	µg/ft <sup>2</sup>	139/9.3
			Barium	183.00	µg/ft <sup>2</sup>	
			Cadmium	4.16	µg/ft <sup>2</sup>	27.9/1.9
			Chromium	52.60	µg/ft <sup>2</sup>	
			Lead	392.00	µg/ft <sup>2</sup>	250/40
			Selenium	4.40	µg/ft <sup>2</sup>	

Sample Number	Location	Area Description	Analyte	Result	Units	Recommended Limit (*)
104-4-3	Building 104 Electrical Vault 4	Transformer - Lower Level	Silver	< 2.50	µg/ft <sup>2</sup>	139/9.3
			Arsenic	3.33	µg/ft <sup>2</sup>	139/9.3
			Barium	185.00	µg/ft <sup>2</sup>	
			Cadmium	3.35	µg/ft <sup>2</sup>	27.9/1.9
			Chromium	50.30	µg/ft <sup>2</sup>	
			Lead	400.00	µg/ft <sup>2</sup>	250/40
			Selenium	7.90	µg/ft <sup>2</sup>	
104-5-1	Building 104 Electrical Vault 5	Dry Transformer - Upper Level	Silver	< 2.50	µg/ft <sup>2</sup>	139/9.3
			Arsenic	< 2.50	µg/ft <sup>2</sup>	139/9.3
			Barium	200.00	µg/ft <sup>2</sup>	
			Cadmium	1.90	µg/ft <sup>2</sup>	27.9/1.9
			Chromium	11.00	µg/ft <sup>2</sup>	
			Lead	76.30	µg/ft <sup>2</sup>	250/40
			Selenium	< 2.50	µg/ft <sup>2</sup>	
104-5-2	Building 104 Electrical Vault 5	Metal Floor - Upper Level	Silver	< 2.50	µg/ft <sup>2</sup>	139/9.3
			Arsenic	< 2.50	µg/ft <sup>2</sup>	139/9.3
			Barium	107.00	µg/ft <sup>2</sup>	
			Cadmium	5.20	µg/ft <sup>2</sup>	27.9/1.9
			Chromium	13.50	µg/ft <sup>2</sup>	
			Lead	263.00	µg/ft <sup>2</sup>	250/40
			Selenium	< 2.50	µg/ft <sup>2</sup>	
104-5-3	Building 104 Electrical Vault 5	Concrete Floor - Lower Level	Silver	< 2.50	µg/ft <sup>2</sup>	139/9.3
			Arsenic	6.54	µg/ft <sup>2</sup>	139/9.3
			Barium	231.00	µg/ft <sup>2</sup>	
			Cadmium	11.20	µg/ft <sup>2</sup>	27.9/1.9
			Chromium	39.60	µg/ft <sup>2</sup>	
			Lead	708.00	µg/ft <sup>2</sup>	250/40
			Selenium	7.80	µg/ft <sup>2</sup>	
105-1-1	Building 105 Electrical Vault 1	Metal Floor - Upper Level	Silver	< 2.50	µg/ft <sup>2</sup>	139/9.3
			Arsenic	4.70	µg/ft <sup>2</sup>	139/9.3
			Barium	450.00	µg/ft <sup>2</sup>	
			Cadmium	4.15	µg/ft <sup>2</sup>	27.9/1.9
			Chromium	42.00	µg/ft <sup>2</sup>	
			Lead	325.00	µg/ft <sup>2</sup>	250/40
			Selenium	5.73	µg/ft <sup>2</sup>	
105-1-2	Building 105 Electrical Vault 1	Transformer - Upper level	Silver	< 2.50	µg/ft <sup>2</sup>	139/9.3
			Arsenic	11.70	µg/ft <sup>2</sup>	139/9.3
			Barium	176.00	µg/ft <sup>2</sup>	
			Cadmium	20.40	µg/ft <sup>2</sup>	27.9/1.9
			Chromium	61.30	µg/ft <sup>2</sup>	
			Lead	408.00	µg/ft <sup>2</sup>	250/40
			Selenium	15.30	µg/ft <sup>2</sup>	

Sample Number	Location	Area Description	Analyte	Result	Units	Recommended Limit (*)
105-1-3	Building 105 Electrical Vault 1	Transformer - Lower level	Silver	< 2.50	µg/ft <sup>2</sup>	139/9.3
			Arsenic	20.70	µg/ft <sup>2</sup>	139/9.3
			Barium	394.00	µg/ft <sup>2</sup>	
			Cadmium	10.50	µg/ft <sup>2</sup>	27.9/1.9
			Chromium	330.00	µg/ft <sup>2</sup>	
			Lead	3360.00	µg/ft <sup>2</sup>	250/40
			Selenium	36.50	µg/ft <sup>2</sup>	
105-1-4	Building 105 Electrical Vault 1	Concrete Floor - Lower Level	Silver	< 2.50	µg/ft <sup>2</sup>	139/9.3
			Arsenic	4.17	µg/ft <sup>2</sup>	139/9.3
			Barium	261.00	µg/ft <sup>2</sup>	
			Cadmium	8.10	µg/ft <sup>2</sup>	27.9/1.9
			Chromium	33.70	µg/ft <sup>2</sup>	
			Lead	260.00	µg/ft <sup>2</sup>	250/40
			Selenium	5.20	µg/ft <sup>2</sup>	
105-2-1	Building 105 Electrical Vault 2	Concrete Floor - Upper Level	Silver	3.40	µg/ft <sup>2</sup>	139/9.3
			Arsenic	8.90	µg/ft <sup>2</sup>	139/9.3
			Barium	620.00	µg/ft <sup>2</sup>	
			Cadmium	3.40	µg/ft <sup>2</sup>	27.9/1.9
			Chromium	47.40	µg/ft <sup>2</sup>	
			Lead	844.00	µg/ft <sup>2</sup>	250/40
			Selenium	5.02	µg/ft <sup>2</sup>	
105-2-2	Building 105 Electrical Vault 2	Transformer - Lower level	Silver	< 2.50	µg/ft <sup>2</sup>	139/9.3
			Arsenic	10.30	µg/ft <sup>2</sup>	139/9.3
			Barium	80.80	µg/ft <sup>2</sup>	
			Cadmium	6.45	µg/ft <sup>2</sup>	27.9/1.9
			Chromium	106.00	µg/ft <sup>2</sup>	
			Lead	7300.00	µg/ft <sup>2</sup>	250/40
			Selenium	15.00	µg/ft <sup>2</sup>	
105-2-3	Building 105 Electrical Vault 2	Concrete Floor - Lower Level	Silver	< 2.50	µg/ft <sup>2</sup>	139/9.3
			Arsenic	6.00	µg/ft <sup>2</sup>	139/9.3
			Barium	240.00	µg/ft <sup>2</sup>	
			Cadmium	6.20	µg/ft <sup>2</sup>	27.9/1.9
			Chromium	33.00	µg/ft <sup>2</sup>	
			Lead	243.00	µg/ft <sup>2</sup>	250/40
			Selenium	9.46	µg/ft <sup>2</sup>	
105-3-1	Building 105 Electrical Vault 3	Dry Transformer - Upper Level	Silver	< 2.50	µg/ft <sup>2</sup>	139/9.3
			Arsenic	< 2.50	µg/ft <sup>2</sup>	139/9.3
			Barium	384.00	µg/ft <sup>2</sup>	
			Cadmium	4.48	µg/ft <sup>2</sup>	27.9/1.9
			Chromium	11.30	µg/ft <sup>2</sup>	
			Lead	98.40	µg/ft <sup>2</sup>	250/40
			Selenium	< 2.50	µg/ft <sup>2</sup>	

Sample Number	Location	Area Description	Analyte	Result	Units	Recommended Limit (*)
105-3-2	Building 105 Electrical Vault 3	Metal Floor - Upper Level	Silver	< 2.50	µg/ft <sup>2</sup>	139/9.3
			Arsenic	4.70	µg/ft <sup>2</sup>	139/9.3
			Barium	353.00	µg/ft <sup>2</sup>	
			Cadmium	21.50	µg/ft <sup>2</sup>	27.9/1.9
			Chromium	46.00	µg/ft <sup>2</sup>	
			Lead	555.00	µg/ft <sup>2</sup>	250/40
			Selenium	7.50	µg/ft <sup>2</sup>	
105-3-3	Building 105 Electrical Vault 3	Transformer (Face) - Lower Level	Silver	< 2.50	µg/ft <sup>2</sup>	139/9.3
			Arsenic	< 2.50	µg/ft <sup>2</sup>	139/9.3
			Barium	15.00	µg/ft <sup>2</sup>	
			Cadmium	< 2.50	µg/ft <sup>2</sup>	27.9/1.9
			Chromium	< 2.50	µg/ft <sup>2</sup>	
			Lead	16.00	µg/ft <sup>2</sup>	250/40
			Selenium	< 2.50	µg/ft <sup>2</sup>	
105-3-4	Building 105 Electrical Vault 3	Concrete Floor - Lower Level	Silver	8.80	µg/ft <sup>2</sup>	139/9.3
			Arsenic	3.15	µg/ft <sup>2</sup>	139/9.3
			Barium	254.00	µg/ft <sup>2</sup>	
			Cadmium	105.00	µg/ft <sup>2</sup>	27.9/1.9
			Chromium	42.40	µg/ft <sup>2</sup>	
			Lead	360.00	µg/ft <sup>2</sup>	250/40
			Selenium	5.41	µg/ft <sup>2</sup>	
105-4-1	Building 105 Electrical Vault 4	Transformer - Upper level	Silver	< 2.50	µg/ft <sup>2</sup>	139/9.3
			Arsenic	3.20	µg/ft <sup>2</sup>	139/9.3
			Barium	278.00	µg/ft <sup>2</sup>	
			Cadmium	3.80	µg/ft <sup>2</sup>	27.9/1.9
			Chromium	28.40	µg/ft <sup>2</sup>	
			Lead	252.00	µg/ft <sup>2</sup>	250/40
			Selenium	4.64	µg/ft <sup>2</sup>	
105-4-2	Building 105 Electrical Vault 4	Concrete Floor - Upper Level	Silver	< 2.50	µg/ft <sup>2</sup>	139/9.3
			Arsenic	< 2.50	µg/ft <sup>2</sup>	139/9.3
			Barium	273.00	µg/ft <sup>2</sup>	
			Cadmium	8.40	µg/ft <sup>2</sup>	27.9/1.9
			Chromium	64.50	µg/ft <sup>2</sup>	
			Lead	10370.00	µg/ft <sup>2</sup>	250/40
			Selenium	3.82	µg/ft <sup>2</sup>	
105-4-3	Building 105 Electrical Vault 4	Transformer - Lower Level	Silver	< 2.50	µg/ft <sup>2</sup>	139/9.3
			Arsenic	4.80	µg/ft <sup>2</sup>	139/9.3
			Barium	260.00	µg/ft <sup>2</sup>	
			Cadmium	13.00	µg/ft <sup>2</sup>	27.9/1.9
			Chromium	73.70	µg/ft <sup>2</sup>	
			Lead	1250.00	µg/ft <sup>2</sup>	250/40
			Selenium	10.50	µg/ft <sup>2</sup>	

Sample Number	Location	Area Description	Analyte	Result	Units	Recommended Limit (*)
105-5-1	Building 105 Electrical Vault 5	Metal Floor - Upper Level	Silver	< 2.50	µg/ft <sup>2</sup>	139/9.3
			Arsenic	3.24	µg/ft <sup>2</sup>	139/9.3
			Barium	550.00	µg/ft <sup>2</sup>	
			Cadmium	12.30	µg/ft <sup>2</sup>	27.9/1.9
			Chromium	35.80	µg/ft <sup>2</sup>	
			Lead	340.00	µg/ft <sup>2</sup>	250/40
			Selenium	4.90	µg/ft <sup>2</sup>	
105-5-2	Building 105 Electrical Vault 5	Transformer - Lower Level	Silver	< 2.50	µg/ft <sup>2</sup>	139/9.3
			Arsenic	3.78	µg/ft <sup>2</sup>	139/9.3
			Barium	740.00	µg/ft <sup>2</sup>	
			Cadmium	3.65	µg/ft <sup>2</sup>	27.9/1.9
			Chromium	54.00	µg/ft <sup>2</sup>	
			Lead	149.00	µg/ft <sup>2</sup>	250/40
			Selenium	5.45	µg/ft <sup>2</sup>	
105-5-3	Building 105 Electrical Vault 5	Concrete Floor - Lower Level	Silver	< 2.50	µg/ft <sup>2</sup>	139/9.3
			Arsenic	9.33	µg/ft <sup>2</sup>	139/9.3
			Barium	435.00	µg/ft <sup>2</sup>	
			Cadmium	4.30	µg/ft <sup>2</sup>	27.9/1.9
			Chromium	110.00	µg/ft <sup>2</sup>	
			Lead	212.00	µg/ft <sup>2</sup>	250/40
			Selenium	8.30	µg/ft <sup>2</sup>	
105-6-1	Building 105 Electrical Vault 6	Concrete Floor - Upper Level	Silver	< 2.50	µg/ft <sup>2</sup>	139/9.3
			Arsenic	< 2.50	µg/ft <sup>2</sup>	139/9.3
			Barium	125.00	µg/ft <sup>2</sup>	
			Cadmium	2.94	µg/ft <sup>2</sup>	27.9/1.9
			Chromium	16.80	µg/ft <sup>2</sup>	
			Lead	140.00	µg/ft <sup>2</sup>	250/40
			Selenium	4.18	µg/ft <sup>2</sup>	
105-6-2	Building 105 Electrical Vault 6	Concrete Floor - Lower Level	Silver	5.48	µg/ft <sup>2</sup>	139/9.3
			Arsenic	< 2.50	µg/ft <sup>2</sup>	139/9.3
			Barium	168.00	µg/ft <sup>2</sup>	
			Cadmium	4.03	µg/ft <sup>2</sup>	27.9/1.9
			Chromium	22.70	µg/ft <sup>2</sup>	
			Lead	195.00	µg/ft <sup>2</sup>	250/40
			Selenium	3.80	µg/ft <sup>2</sup>	
105-6-3	Building 105 Electrical Vault 6	Transformer - Lower Level	Silver	< 2.50	µg/ft <sup>2</sup>	139/9.3
			Arsenic	< 2.50	µg/ft <sup>2</sup>	139/9.3
			Barium	20.80	µg/ft <sup>2</sup>	
			Cadmium	< 2.50	µg/ft <sup>2</sup>	27.9/1.9
			Chromium	< 2.50	µg/ft <sup>2</sup>	
			Lead	13.00	µg/ft <sup>2</sup>	250/40
			Selenium	< 2.50	µg/ft <sup>2</sup>	

Sample Number	Location	Area Description	Analyte	Result	Units	Recommended Limit (*)
107-1-1	Building 107 Electrical Vault 1	Transformer - Lower Level	Silver	< 2.50	µg/ft <sup>2</sup>	139/9.3
			Arsenic	< 2.50	µg/ft <sup>2</sup>	139/9.3
			Barium	36.70	µg/ft <sup>2</sup>	
			Cadmium	< 2.50	µg/ft <sup>2</sup>	27.9/1.9
			Chromium	< 2.50	µg/ft <sup>2</sup>	
			Lead	6.16	µg/ft <sup>2</sup>	250/40
			Selenium	< 2.50	µg/ft <sup>2</sup>	
107-1-2	Building 107 Electrical Vault 1	Concrete Floor - Lower Level	Silver	< 2.50	µg/ft <sup>2</sup>	139/9.3
			Arsenic	< 2.50	µg/ft <sup>2</sup>	139/9.3
			Barium	31.50	µg/ft <sup>2</sup>	
			Cadmium	< 2.50	µg/ft <sup>2</sup>	27.9/1.9
			Chromium	9.65	µg/ft <sup>2</sup>	
			Lead	50.00	µg/ft <sup>2</sup>	250/40
			Selenium	4.30	µg/ft <sup>2</sup>	
107-1-3	Building 107 Electrical Vault 1	Concrete Floor - SW Side of Lower Level	Silver	< 2.50	µg/ft <sup>2</sup>	139/9.3
			Arsenic	< 2.50	µg/ft <sup>2</sup>	139/9.3
			Barium	35.60	µg/ft <sup>2</sup>	
			Cadmium	< 2.50	µg/ft <sup>2</sup>	27.9/1.9
			Chromium	5.60	µg/ft <sup>2</sup>	
			Lead	33.40	µg/ft <sup>2</sup>	250/40
			Selenium	< 2.50	µg/ft <sup>2</sup>	
107-1-4	Building 107 Electrical Vault 1	Transformer (Face) - Lower Level	Silver	< 2.50	µg/ft <sup>2</sup>	139/9.3
			Arsenic	< 2.50	µg/ft <sup>2</sup>	139/9.3
			Barium	3.24	µg/ft <sup>2</sup>	
			Cadmium	< 2.50	µg/ft <sup>2</sup>	27.9/1.9
			Chromium	< 2.50	µg/ft <sup>2</sup>	
			Lead	< 2.50	µg/ft <sup>2</sup>	250/40
			Selenium	< 2.50	µg/ft <sup>2</sup>	
108A-1-1	Building 108A	Concrete Floor West Side	Silver	< 2.50	µg/ft <sup>2</sup>	139/9.3
			Arsenic	< 2.50	µg/ft <sup>2</sup>	139/9.3
			Barium	330.00	µg/ft <sup>2</sup>	
			Cadmium	4.00	µg/ft <sup>2</sup>	27.9/1.9
			Chromium	21.50	µg/ft <sup>2</sup>	
			Lead	527.00	µg/ft <sup>2</sup>	250/40
			Selenium	3.75	µg/ft <sup>2</sup>	
108A-1-2	Building 108A	East Side of Containment Floor for TR-1	Silver	< 2.50	µg/ft <sup>2</sup>	139/9.3
			Arsenic	3.22	µg/ft <sup>2</sup>	139/9.3
			Barium	185.00	µg/ft <sup>2</sup>	
			Cadmium	< 2.50	µg/ft <sup>2</sup>	27.9/1.9
			Chromium	62.50	µg/ft <sup>2</sup>	
			Lead	1024.00	µg/ft <sup>2</sup>	250/40
			Selenium	3.00	µg/ft <sup>2</sup>	

Sample Number	Location	Area Description	Analyte	Result	Units	Recommended Limit (*)
108A-1-3	Building 108A	South Side Face of TR-2	Silver	< 2.50	µg/ft <sup>2</sup>	139/9.3
			Arsenic	< 2.50	µg/ft <sup>2</sup>	139/9.3
			Barium	11.00	µg/ft <sup>2</sup>	
			Cadmium	< 2.50	µg/ft <sup>2</sup>	27.9/1.9
			Chromium	< 2.50	µg/ft <sup>2</sup>	
			Lead	200.00	µg/ft <sup>2</sup>	250/40
			Selenium	< 2.50	µg/ft <sup>2</sup>	
108A-1-4	Building 108A	Top of 4 Phase Relay	Silver	< 2.50	µg/ft <sup>2</sup>	139/9.3
			Arsenic	3.50	µg/ft <sup>2</sup>	139/9.3
			Barium	211.00	µg/ft <sup>2</sup>	
			Cadmium	36.00	µg/ft <sup>2</sup>	27.9/1.9
			Chromium	20.70	µg/ft <sup>2</sup>	
			Lead	314.00	µg/ft <sup>2</sup>	250/40
			Selenium	4.92	µg/ft <sup>2</sup>	
108B-1-1	Building 108B	Top of 4 Phase Relay	Silver	< 2.50	µg/ft <sup>2</sup>	139/9.3
			Arsenic	3.74	µg/ft <sup>2</sup>	139/9.3
			Barium	144.00	µg/ft <sup>2</sup>	
			Cadmium	7.10	µg/ft <sup>2</sup>	27.9/1.9
			Chromium	31.70	µg/ft <sup>2</sup>	
			Lead	780.00	µg/ft <sup>2</sup>	250/40
			Selenium	4.00	µg/ft <sup>2</sup>	
108B-1-2	Building 108B	Below TR-2 Middle of Building	Silver	< 2.50	µg/ft <sup>2</sup>	139/9.3
			Arsenic	< 2.50	µg/ft <sup>2</sup>	139/9.3
			Barium	210.00	µg/ft <sup>2</sup>	
			Cadmium	< 2.50	µg/ft <sup>2</sup>	27.9/1.9
			Chromium	46.50	µg/ft <sup>2</sup>	
			Lead	4860.00	µg/ft <sup>2</sup>	250/40
			Selenium	3.15	µg/ft <sup>2</sup>	
108B-1-3	Building 108B	Concrete Floor NE Side	Silver	< 2.50	µg/ft <sup>2</sup>	139/9.3
			Arsenic	< 2.50	µg/ft <sup>2</sup>	139/9.3
			Barium	470.00	µg/ft <sup>2</sup>	
			Cadmium	5.90	µg/ft <sup>2</sup>	27.9/1.9
			Chromium	22.00	µg/ft <sup>2</sup>	
			Lead	490.00	µg/ft <sup>2</sup>	250/40
			Selenium	< 2.50	µg/ft <sup>2</sup>	
108B-1-4	Building 108B	North Face of TR-1	Silver	< 2.50	µg/ft <sup>2</sup>	139/9.3
			Arsenic	< 2.50	µg/ft <sup>2</sup>	139/9.3
			Barium	18.70	µg/ft <sup>2</sup>	
			Cadmium	< 2.50	µg/ft <sup>2</sup>	27.9/1.9
			Chromium	< 2.50	µg/ft <sup>2</sup>	
			Lead	145.00	µg/ft <sup>2</sup>	250/40
			Selenium	< 2.50	µg/ft <sup>2</sup>	

Sample Number	Location	Area Description	Analyte	Result	Units	Recommended Limit (*)
110-1-1	Building 110 Electrical Vault 1	Metal Floor - Upper Level	Silver	< 2.50	µg/ft <sup>2</sup>	139/9.3
			Arsenic	< 2.50	µg/ft <sup>2</sup>	139/9.3
			Barium	70.40	µg/ft <sup>2</sup>	
			Cadmium	3.64	µg/ft <sup>2</sup>	27.9/1.9
			Chromium	9.56	µg/ft <sup>2</sup>	
			Lead	183.00	µg/ft <sup>2</sup>	250/40
			Selenium	< 2.50	µg/ft <sup>2</sup>	
110-1-2	Building 110 Electrical Vault 1	Concrete Floor - Lower Level	Silver	< 2.50	µg/ft <sup>2</sup>	139/9.3
			Arsenic	< 2.50	µg/ft <sup>2</sup>	139/9.3
			Barium	70.60	µg/ft <sup>2</sup>	
			Cadmium	2.90	µg/ft <sup>2</sup>	27.9/1.9
			Chromium	9.70	µg/ft <sup>2</sup>	
			Lead	165.00	µg/ft <sup>2</sup>	250/40
			Selenium	< 2.50	µg/ft <sup>2</sup>	
110-1-3	Building 110 Electrical Vault 1	Transformer - Lower Level	Silver	< 2.50	µg/ft <sup>2</sup>	139/9.3
			Arsenic	< 2.50	µg/ft <sup>2</sup>	139/9.3
			Barium	52.30	µg/ft <sup>2</sup>	
			Cadmium	< 2.50	µg/ft <sup>2</sup>	27.9/1.9
			Chromium	3.52	µg/ft <sup>2</sup>	
			Lead	42.60	µg/ft <sup>2</sup>	250/40
			Selenium	< 2.50	µg/ft <sup>2</sup>	
110-2-1	Building 110 Electrical Vault 2	Metal Floor - Upper Level	Silver	< 2.50	µg/ft <sup>2</sup>	139/9.3
			Arsenic	5.25	µg/ft <sup>2</sup>	139/9.3
			Barium	284.00	µg/ft <sup>2</sup>	
			Cadmium	5.38	µg/ft <sup>2</sup>	27.9/1.9
			Chromium	91.00	µg/ft <sup>2</sup>	
			Lead	3210.00	µg/ft <sup>2</sup>	250/40
			Selenium	8.00	µg/ft <sup>2</sup>	
110-2-2	Building 110 Electrical Vault 2	Concrete Floor - Lower Level	Silver	< 2.50	µg/ft <sup>2</sup>	139/9.3
			Arsenic	< 2.50	µg/ft <sup>2</sup>	139/9.3
			Barium	122.00	µg/ft <sup>2</sup>	
			Cadmium	3.13	µg/ft <sup>2</sup>	27.9/1.9
			Chromium	19.80	µg/ft <sup>2</sup>	
			Lead	233.00	µg/ft <sup>2</sup>	250/40
			Selenium	< 2.50	µg/ft <sup>2</sup>	
110-2-3	Building 110 Electrical Vault 2	Top of Transformer	Silver	< 2.50	µg/ft <sup>2</sup>	139/9.3
			Arsenic	< 2.50	µg/ft <sup>2</sup>	139/9.3
			Barium	120.00	µg/ft <sup>2</sup>	
			Cadmium	< 2.50	µg/ft <sup>2</sup>	27.9/1.9
			Chromium	9.40	µg/ft <sup>2</sup>	
			Lead	105.00	µg/ft <sup>2</sup>	250/40
			Selenium	< 2.50	µg/ft <sup>2</sup>	

Sample Number	Location	Area Description	Analyte	Result	Units	Recommended Limit (*)
FB-1	NA	NA	Silver	< 2.50	µg/ft <sup>2</sup>	139/9.3
			Arsenic	< 2.50	µg/ft <sup>2</sup>	139/9.3
			Barium	< 2.50	µg/ft <sup>2</sup>	
			Cadmium	< 2.50	µg/ft <sup>2</sup>	27.9/1.9
			Chromium	< 2.50	µg/ft <sup>2</sup>	
			Lead	< 2.50	µg/ft <sup>2</sup>	250/40
			Selenium	< 2.50	µg/ft <sup>2</sup>	
FB-2	NA	NA	Silver	< 2.50	µg/ft <sup>2</sup>	139/9.3
			Arsenic	< 2.50	µg/ft <sup>2</sup>	139/9.3
			Barium	< 2.50	µg/ft <sup>2</sup>	
			Cadmium	< 2.50	µg/ft <sup>2</sup>	27.9/1.9
			Chromium	< 2.50	µg/ft <sup>2</sup>	
			Lead	< 2.50	µg/ft <sup>2</sup>	250/40
			Selenium	< 2.50	µg/ft <sup>2</sup>	
FB-3	NA	NA	Silver	< 2.50	µg/ft <sup>2</sup>	139/9.3
			Arsenic	< 2.50	µg/ft <sup>2</sup>	139/9.3
			Barium	< 2.50	µg/ft <sup>2</sup>	
			Cadmium	< 2.50	µg/ft <sup>2</sup>	27.9/1.9
			Chromium	< 2.50	µg/ft <sup>2</sup>	
			Lead	< 2.50	µg/ft <sup>2</sup>	250/40
			Selenium	< 2.50	µg/ft <sup>2</sup>	
FB-4	NA	NA	Silver	< 2.50	µg/ft <sup>2</sup>	139/9.3
			Arsenic	< 2.50	µg/ft <sup>2</sup>	139/9.3
			Barium	< 2.50	µg/ft <sup>2</sup>	
			Cadmium	< 2.50	µg/ft <sup>2</sup>	27.9/1.9
			Chromium	< 2.50	µg/ft <sup>2</sup>	
			Lead	< 2.50	µg/ft <sup>2</sup>	250/40
			Selenium	< 2.50	µg/ft <sup>2</sup>	
FB-5	NA	NA	Silver	< 2.50	µg/ft <sup>2</sup>	139/9.3
			Arsenic	< 2.50	µg/ft <sup>2</sup>	139/9.3
			Barium	< 2.50	µg/ft <sup>2</sup>	
			Cadmium	< 2.50	µg/ft <sup>2</sup>	27.9/1.9
			Chromium	< 2.50	µg/ft <sup>2</sup>	
			Lead	< 2.50	µg/ft <sup>2</sup>	250/40
			Selenium	< 2.50	µg/ft <sup>2</sup>	
FB-6	NA	NA	Silver	< 2.50	µg/ft <sup>2</sup>	139/9.3
			Arsenic	< 2.50	µg/ft <sup>2</sup>	139/9.3
			Barium	< 2.50	µg/ft <sup>2</sup>	
			Cadmium	< 2.50	µg/ft <sup>2</sup>	27.9/1.9
			Chromium	< 2.50	µg/ft <sup>2</sup>	
			Lead	< 2.50	µg/ft <sup>2</sup>	250/40
			Selenium	< 2.50	µg/ft <sup>2</sup>	


Sample Number	Location	Area Description	Analyte	Result	Units	Recommended Limit (*)
FB-7	NA	NA	Silver	< 2.50	µg/ft <sup>2</sup>	139/9.3
			Arsenic	< 2.50	µg/ft <sup>2</sup>	139/9.3
			Barium	< 2.50	µg/ft <sup>2</sup>	
			Cadmium	< 2.50	µg/ft <sup>2</sup>	27.9/1.9
			Chromium	< 2.50	µg/ft <sup>2</sup>	
			Lead	< 2.50	µg/ft <sup>2</sup>	250/40
			Selenium	< 2.50	µg/ft <sup>2</sup>	
FB-8	NA	NA	Silver	< 2.50	µg/ft <sup>2</sup>	139/9.3
			Arsenic	< 2.50	µg/ft <sup>2</sup>	139/9.3
			Barium	< 2.50	µg/ft <sup>2</sup>	
			Cadmium	< 2.50	µg/ft <sup>2</sup>	27.9/1.9
			Chromium	< 2.50	µg/ft <sup>2</sup>	
			Lead	< 2.50	µg/ft <sup>2</sup>	250/40
			Selenium	< 2.50	µg/ft <sup>2</sup>	

\* Recommended Limits based on Table 3 (BNL Surface Wipe Criteria for Metals) of the Brookhaven Surface Wipe Sampling Procedure (IH75190)

# **Appendix**

## **B**

### Sample Location Maps

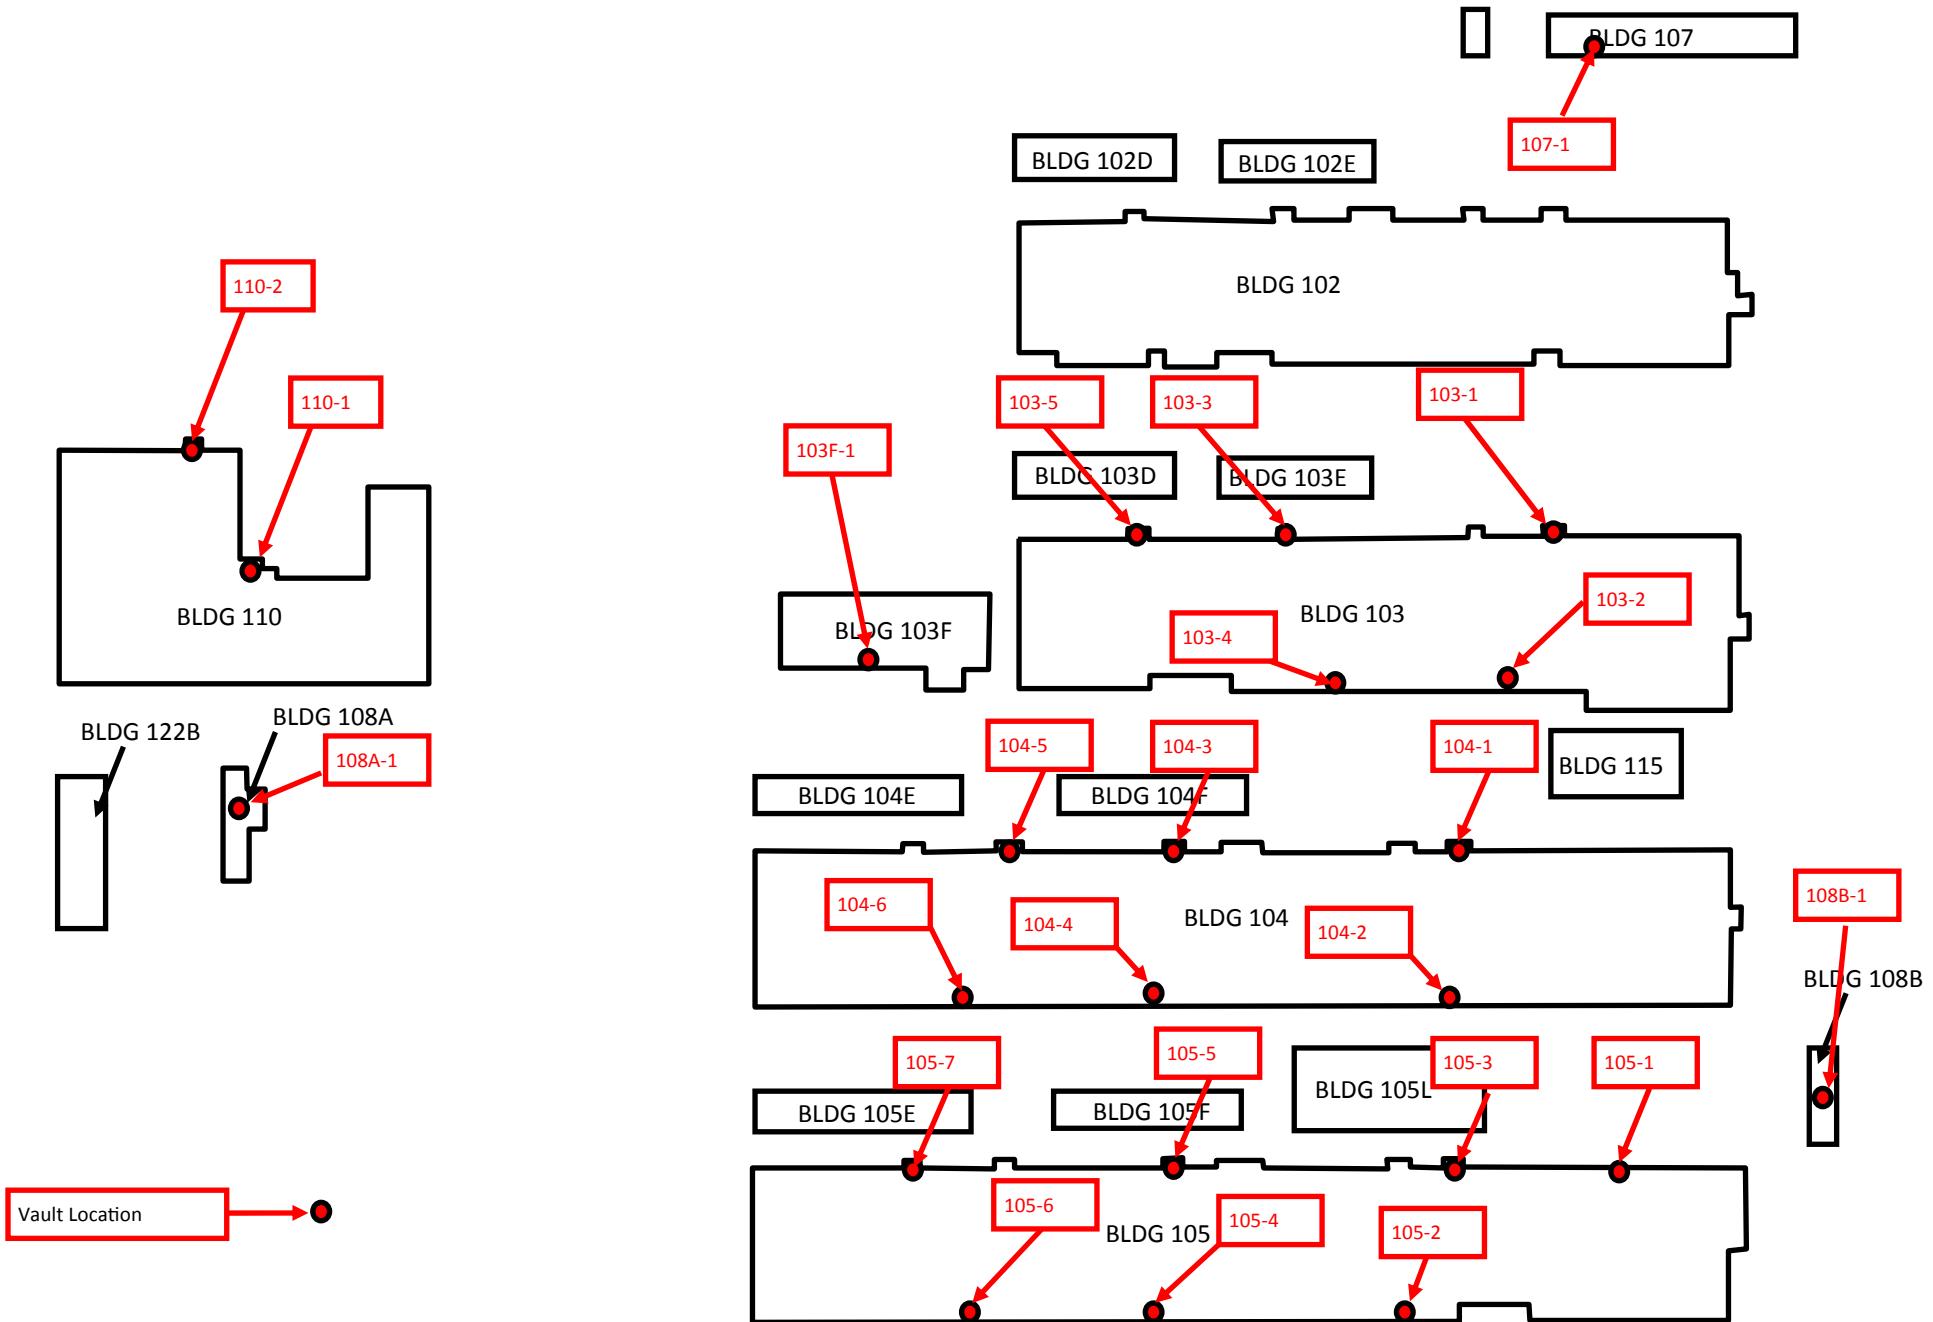

# **Appendix C**

Laboratory  
Analytical  
Reports

# SanAir Technologies Laboratory

## Analysis Report

prepared for

**Occu-Tec**

Report Date: 9/19/2017  
Project Name: Electrical Vault Wipe Sampling  
Project #: 917004.002  
SanAir ID#: 17035951



NVLAP LAB CODE 200870-0



Certification # 652931



License # LAB0166



**804.897.1177**

**www.sanair.com**



# SanAir Technologies Laboratory, Inc.

1551 Oakbridge Drive, Suite B, Powhatan, VA 23139  
804.897.1177 Toll Free: 888.895.1177 Fax: 804.897.0070  
Web: <http://www.sanair.com> E-mail: iaq@sanair.com

Occu-Tec  
100 NW Business Park Lane  
Riverside, MO 64150

September 19, 2017

SanAir ID # 17035951  
Project Name: Electrical Vault Wipe Sampling  
Project Number: 917004.002


Dear Justin Arnold,

We at SanAir would like to thank you for the work you recently submitted. The 80 sample(s) were received on Tuesday, September 12, 2017 via FedEx. The final report(s) is enclosed for the following sample(s): 103-1-1, 103-1-2, 103-1-3, 103-1-4, 103-2-1, 103-2-2, 103-2-3, 103-2-4, 103-3-1, 103-3-2, 103-3-3, 103-4-1, 103-4-2, 103-4-3, 103F-1-1, 103F-1-2, 103F-1-3, 104-1-1, 104-1-2, 104-1-3, 104-1-4, 104-2-1, 104-2-2, 104-2-3, 104-2-4, 104-3-1, 104-3-2, 104-3-3, 104-4-1, 104-4-2, 104-4-3, 104-5-1, 104-5-2, 104-5-3, 105-1-1, 105-1-2, 105-1-3, 105-1-4, 105-2-1, 105-2-2, 105-2-3, 105-3-1, 105-3-2, 105-3-3, 105-3-4, 105-4-1, 105-4-2, 105-4-3, 105-5-1, 105-5-2, 105-5-3, 105-6-1, 105-6-2, 105-6-3, 107-1-1, 107-1-2, 107-1-3, 107-1-4, 108A-1-1, 108A-1-2, 108A-1-3, 108A-1-4, 108B-1-1, 108B-1-2, 108B-1-3, 108B-1-4, 110-1-1, 110-1-2, 110-1-3, 110-2-1, 110-2-2, 110-2-3, FB-1, FB-2, FB-3, FB-4, FB-5, FB-6, FB-7, FB-8.

These results only pertain to this job and should not be used in the interpretation of any other job. This report is only complete in its entirety. Refer to the listing below of the pages included in a complete final report.

Sincerely,

(b) (6)



Abisola Kasali  
Metals Laboratory Director  
SanAir Technologies Laboratory

Final Report Includes:  
- Cover Letter  
- Analysis Pages  
- Disclaimers and Additional Information

sample conditions:  
80 sample(s) in Good condition



1551 Oakbridge Dr STE B  
Powhatan, VA 23139  
804.897.1177 / 888.895.1177  
Fax 804.897.0070  
sanair.com

**Metals & Lead  
Chain of Custody**

Form 70, Revision 9, 01/19/2017

SanAir ID Number

17035951

Company: OCCU-TEC	Project #: 917004.002	Phone #: 816-810-3276
Address: 100 NW Business Park Lane	Project Name: Electrical Vault Wipe Sampling	Phone #: 816-994-3428
City, St., Zip: Riverside, MO 64150	Date Collected: 7-9-2017	Fax #: 816-994-3478
Samples Collected By: Justin Arnold	P.O. Number:	Email: jarnold@occutech.com
Account #:	U.S. State Collected in: Missouri	Email:

**Matrix Types**

**Metals Analysis Types**

Air (ug/m³)	Total Concentration of Lead	ICP-total concentration of metals (please list metals):
Wipe (ug/ft²)	Total Concentration of RCRA 8 Metals	
Paint      Soil      Bulk (ug/g or ppm)	TCLP for Lead	Do Not Include Mercury
Other:	TCLP for RCRA 8 Metals	
Turn Around Time	Same Day	1 Day
	Standard (5 day)	Full TCLP (10d)
		2 days
		3 Days

Sample #	Collection Date & Time	Sample Identification/Location	Flow Rate	Start Time	Stop Time	Volume (L) Area (Sq ft)
103-1-1	7:44 AM	Vault Floor - Upper Level				1 SF
103-1-2	7:48 AM	Top of Cabinet - Upper Level				1 SF
103-1-3	7:53 AM	Vault Floor - Lower Level				1 SF
103-1-4	7:55 AM	Cabinet Lower Level				1 SF
103-2-1	8:36 AM	Vault Floor Concrete - Upper Level				1 SF
103-2-2	8:40 AM	Switch Board #506349 - Upper Level				1 SF
103-2-3	8:45 AM	Vault FLoor Concrete - Lower Level				1 SF
103-2-4	8:48 AM	Switch Gear (Face) - Lower Level				1 SF
103-3-1	8:05 AM	Top of Duct SW Side - Upper Level				1 SF
103-3-2	8:09 AM	Vault Floor - Lower Level				1 SF
103-3-3	8:12 AM	Transformer #508900 - Lower Level				1 SF
103-4-1	8:22 AM	Vault Floor Colncrete - Upper Level				1 SF
103-4-2	8:26 AM	Dry Transformer #500848				1 SF
103-4-3	8:28 AM	Vault Floor Concrete - Lower Level				1 SF

Special Instructions	
----------------------	--

Relinquished by	Date	Time	Received by	Date	Time
(b) (6)	9-11-2017		(b) (6)	SEP 12 2017	9:45AM

If no technician is provided, then the primary contact of your account will be selected. Unless scheduled, the turnaround time for all samples received after 3 pm will begin at 8 am the next business morning. Weekend or holiday work must be scheduled ahead of time and is charged at 150% of the Rush TAT rate. There is a minimum charge of \$100 for weekend work. A courier charge will be applied for same day and one-day turnaround times for offsite work. SanAir covers Standard Overnight FedEx shipping. Shipments billed to SanAir with a faster shipping rate will result in additional charges.



1551 Oakbridge Dr STE B  
Powhatan, VA 23139  
804.897.1177 / 888.895.1177  
Fax 804.897.0070  
sanair.com

**Metals & Lead  
Chain of Custody**

Form 70, Revision 9, 01/19/2017

SanAir ID Number

17035951

Company: OCCU-TEC	Project #: 917004.002	Phone #: 816-810-3276
Address: 100 NW Business Park Lane	Project Name: Electrical Vault Wipe Sampling	Phone #: 816-994-3428
City, St., Zip: Riverside, MO 64150	Date Collected: 9-7-2017	Fax #: 816-994-3478
Samples Collected By: Justin Arnold	P.O. Number:	Email: jarnold@occutech.com
Account #:	U.S. State Collected in: Missouri	Email:

**Matrix Types**

**Metals Analysis Types**

Air (ug/m <sup>3</sup> )	Total Concentration of Lead	ICP-total concentration of metals (please list metals):
Wipe (ug/ft <sup>2</sup> )	Total Concentration of RCRA 8 Metals	
Paint    Soil    Bulk (ug/g or ppm)	TCLP for Lead	
Other:	TCLP for RCRA 8 Metals	
Turn Around Time	Same Day	1 Day
	Standard (5 day)	2 days
		3 Days

**Do Not Include Mercury**

Sample #	Collection Date & Time	Sample Identification/Location	Flow Rate	Start Time	Stop Time	Volume (L) Area (Sq ft)
103F-1-1	1:38 PM	Top of Transformer - Lower Level				1 SF
103F-1-2	1:41 PM	Concrete Floor - Lower Level				1 SF
103F-1-3	1:43 PM	Transformer (Face) - Lower Level				1 SF
104-1-1	8:56 AM	Metal Floor - Upper Level				1 SF
104-1-2	8:59 AM	Dry Transformer - Upper Level				1 SF
104-1-3	9:02 AM	Vault Concrete Floor - Lower Level				1 SF
104-1-4	9:05 AM	Switchgear 4AB - Lower Level				1 SF
104-2-1	10:02 AM	Metal Floor - Upper Level				1 SF
104-2-2	10:04 AM	Concrete Floor - Lower Level				1 SF
104-2-3	10:07 AM	Transformer - Lower Level				1 SF
104-2-4	10:10 AM	Concrete Floor North Side - Lower Level				1 SF
104-3-1	9:12 AM	Dry Transformer - Upper Level				1 SF
104-3-2	9:16 AM	Concrete Floor - Lower Level				1 SF
104-3-3	9:19 AM	Power Panel Board - Lower Level				1 SF

**Special Instructions**

Relinquished by	Date	Time	Received by	Date	Time
(b) (6)	9-11-2017		(b) (6)	SEP 12 2017	9:45AM

If no technician is provided, then the primary contact of your account will be selected. Unless scheduled, the turnaround time for all samples received after 3 pm will begin at 8 am the next business morning. Weekend or holiday work must be scheduled ahead of time and is charged at 150% of the Rush TAT rate. There is a minimum charge of \$100 for weekend work. A courier charge will be applied for same day and one-day turnaround times for offsite work. SanAir covers Standard Overnight FedEx shipping. Shipments billed to SanAir with a faster shipping rate will result in additional charges.

Page 2 of 4



1551 Oakbridge Dr STE B  
Powhatan, VA 23139  
804.897.1177 / 888.895.1177  
Fax 804.897.0070  
sanair.com

**Metals & Lead  
Chain of Custody**

Form 70, Revision 9, 01/19/2017

SanAir ID Number

170359151

Company: OCCU-TEC	Project #: 917004.002	Phone #: 816-810-3276
Address: 100 NW Business Park Lane	Project Name: Electrical Vault Wipe Sampling	Phone #: 816-994-3428
City, St., Zip: Riverside, MO 64150	Date Collected: 7-7-2017	Fax #: 816-994-3478
Samples Collected By: Justin Arnold	P.O. Number:	Email: jarnold@occutech.com
Account #:	U.S. State Collected in: Missouri	Email:

**Matrix Types**

**Metals Analysis Types**

Air (ug/m <sup>3</sup> )	Total Concentration of Lead	ICP-total concentration of metals (please list metals):
Wipe (ug/ft <sup>2</sup> )	Total Concentration of RCRA 8 Metals	
Paint      Soil      Bulk (ug/g or ppm)	TCLP for Lead	Do Not Include Mercury
Other:	TCLP for RCRA 8 Metals	
Turn Around Time	Same Day	1 Day
	Standard (5 day)	Full TCLP (10d)
		2 days
		3 Days

Sample #	Collection Date & Time	Sample Identification/Location	Flow Rate	Start Time	Stop Time	Volume (L) Area (Sq ft)
104-4-1	9:45 AM	Dry Transformer - Upper Level				1 SF
104-4-2	9:47 AM	Concrete Floor - Upper Level				1 SF
104-4-3	9:50 PM	Transformer - Lower Level				1 SF
104-5-1	9:28 AM	Dry Transformer - Upper Level				1 SF
104-5-2	9:33 AM	Metal Floor - Upper Level				1 SF
104-5-3	9:30 AM	Concrete Floor - Lower Level				1 SF
105-1-1	10:46 AM	Metal Floor - Upper Level				1 SF
105-1-2	10:48 AM	Transformer - Upper Level				1 SF
105-1-3	10:52 AM	Transformer - Lower Level				1 SF
105-1-4	10:55 AM	Concrete Floor - Lower Level				1 SF
105-2-1	12:10 PM	Concrete Floor - Upper Level				1 SF
105-2-2	12:13 PM	Transformer - Lower Level				1 SF
105-2-3	12:15 PM	Concrete Floor - Lower Level				1 SF
105-3-1	11:01 AM	Dry Transformer - Upper Level				1 SF

Special Instructions	
----------------------	--

Relinquished by	Date	Time	Received by	Date	Time
(b) (6)	9-11-2017		(b) (6)	SEP 12 2017	9:14:51AM

If no technician is provided, then the primary contact of your account will be selected. Unless scheduled, the turnaround time for all samples received after 3 pm will begin at 8 am the next business morning. Weekend or holiday work must be scheduled ahead of time and is charged at 150% of the Rush TAT rate. There is a minimum charge of \$100 for weekend work. A courier charge will be applied for same day and one-day turnaround times for offsite work. SanAir covers Standard Overnight FedEx shipping. Shipments billed to SanAir with a faster shipping rate will result in additional charges.

Page 3 of 6



1551 Oakbridge Dr STE B  
Powhatan, VA 23139  
804.897.1177 / 888.895.1177  
Fax 804.897.0070  
sanair.com

**Metals & Lead  
Chain of Custody**

Form 70, Revision 9, 01/19/2017

SanAir ID Number

17035951

Company: OCCU-TEC	Project #: 917004.002	Phone #: 816-810-3276
Address: 100 NW Business Park Lane	Project Name: Electrical Vault Wipe Sampling	Phone #: 816-994-3428
City, St., Zip: Riverside, MO 64150	Date Collected: 1-7-2017	Fax #: 816-994-3478
Samples Collected By: Justin Arnold	P.O. Number:	Email: jarnold@occutech.com
Account #:	U.S. State Collected in: Missouri	Email:

**Matrix Types**

**Metals Analysis Types**

Air (ug/m <sup>3</sup> )	Total Concentration of Lead	ICP-total concentration of metals (please list metals):
Wipe (ug/f <sup>2</sup> )	Total Concentration of RCRA 8 Metals	
Paint    Soil    Bulk (ug/g or ppm)	TCLP for Lead	
Other:	TCLP for RCRA 8 Metals	
Turn Around Time	Same Day	1 Day
	Standard (5 day)	Full TCLP (10d)
		2 days
		3 Days

**Do Not Include Mercury**

Sample #	Collection Date & Time	Sample Identification/Location	Flow Rate	Start Time	Stop Time	Volume (L) Area (Sq ft)
105-3-2	11:05 AM	Metal Floor - Upper Level				1 SF
105-3-3	11:09 AM	Transformer (Face) - Lower Level				1 SF
105-3-4	11:11 AM	Concrete Floor - Lower Level				1 SF
105-4-1	11:55 AM	Transformer - Upper Level				1 SF
105-4-2	11:58 AM	Concrete Floor - Upper Level				1 SF
105-4-3	12:02 PM	Transformer - Lower Level				1 SF
105-5-1	11:18 AM	Metal Floor - Upper Level				1 SF
105-5-2	11:23 AM	Transformer - Lower Level				1 SF
105-5-3	11:25 AM	Concrete Floor - Lower Level				1 SF
105-6-1	11:36 AM	Concrete Floor - Upper Level				1 SF
105-6-2	11:40 AM	Concrete Floor - Lower Level				1 SF
105-6-3	11:42 AM	Transformer - Lower Level				1 SF
107-1-1	1:22 PM	Transformer - Lower Level				1 SF
107-1-2	1:24 PM	Concrete Floor - Lower Level				1 SF

Special Instructions	
----------------------	--

Relinquished by	Date	Time	Received by	Date	Time
(b) (6)	9-11-2017		(b) (6)	SEP 12 2017	9:45AM

If no technician is provided, then the primary contact of your account will be selected. Unless scheduled, the turnaround time for all samples received after 3 pm will begin at 8 am the next business morning. Weekend or holiday work must be scheduled ahead of time and is charged at 150% of the Rush TAT rate. There is a minimum charge of \$100 for weekend work. A courier charge will be applied for same day and one-day turnaround times for offsite work. SanAir covers Standard Overnight FedEx shipping. Shipments billed to SanAir with a faster shipping rate will result in additional charges.

Page 4 of 6



1551 Oakbridge Dr STE B  
Powhatan, VA 23139  
804.897.1177 / 888.895.1177  
Fax 804.897.0070  
sanair.com

**Metals & Lead  
Chain of Custody**

Form 70, Revision 9, 01/19/2017

SanAir ID Number

17035951

Company: OCCU-TEC	Project #: 917004.002	Phone #: 816-810-3276
Address: 100 NW Business Park Lane	Project Name: Electrical Vault Wipe Sampling	Phone #: 816-994-3428
City, St., Zip: Riverside, MO 64150	Date Collected: 9-7-2017	Fax #: 816-994-3478
Samples Collected By: Justin Arnold	P.O. Number:	Email: jarnold@occutech.com
Account #:	U.S. State Collected in: Missouri	Email:

**Matrix Types**

**Metals Analysis Types**

Air (ug/m³)	Total Concentration of Lead	ICP-total concentration of metals (please list metals):		
Wipe (ug/ft²)	Total Concentration of RCRA 8 Metals			
Paint    Soil    Bulk (ug/g or ppm)	TCLP for Lead			
Other:	TCLP for RCRA 8 Metals			
Turn Around Time	Same Day	1 Day	2 days	3 Days
	<input checked="" type="checkbox"/> Standard (5 day)	— Full TCLP (10d)		

Sample #	Collection Date & Time	Sample Identification/Location	Flow Rate	Start Time	Stop Time	Volume (L) Area (Sq ft)
107-1-3	1:26 PM	Concrete Floor - Lower Level SW Side				1 SF
107-1-4	1:28 PM	Transformer (Face) - Lower Level				1 SF
108A-1-1	2:20 PM	Concrete Floor West Side				1 SF
108A-1-2	2:24 PM	East Side of Containment Floor for TR-1				1 SF
108A-1-3	2:28 PM	South Side Face of TR-2				1 SF
108A-1-4	2:32 PM	Top of 4 Phase Relay				1 SF
108B-1-1	1:53 PM	Top of 4 Phase Relay				1 SF
108B-1-2	1:58 PM	Below TR-2 Middle of Building				1 SF
108B-1-3	2:02 PM	Concrete Floor NE Side				1 SF
108B-1-4	2:07 PM	North Face of TR-1				1 SF
110-1-1	3:06 PM	Metal Floor - Upper Level				1 SF
110-1-2	3:10 PM	Concrete Floor - Lower Level				1 SF
110-1-3	3:12 PM	Transformer - Lower Level				1 SF
110-2-1	2:53 PM	Metal Floor - Upper Level				1 SF

**Special Instructions**

Relinquished by	Date	Time	Received by	Date	Time
(b) (6)	9-11-2017		(b) (6)	SEP 12 2017	9:45 AM

If no technician is provided, then the primary contact of your account will be selected. Unless scheduled, the turnaround time for all samples received after 3 pm will begin at 8 am the next business morning. Weekend or holiday work must be scheduled ahead of time and is charged at 150% of the Rush TAT rate. There is a minimum charge of \$100 for weekend work. A courier charge will be applied for same day and one-day turnaround times for offsite work. SanAir covers Standard Overnight FedEx shipping. Shipments billed to SanAir with a faster shipping rate will result in additional charges.

Page 5 of 6



1551 Oakbridge Dr STE B  
Powhatan, VA 23139  
804.897.1177 / 888.895.1177  
Fax 804.897.0070  
sanair.com

**Metals & Lead  
Chain of Custody**  
Form 70, Revision 9, 01/19/2017

SanAir ID Number

17035951

Company: OCCU-TEC	Project #: 917004.002	Phone #: 816-810-3276
Address: 100 NW Business Park Lane	Project Name: Electrical Vault Wipe Sampling	Phone #: 816-994-3428
City, St., Zip: Riverside, MO 64150	Date Collected: 9-7-2017	Fax #: 816-994-3478
Samples Collected By: Justin Arnold	P.O. Number:	Email: jarnold@occutech.com
Account #:	U.S. State Collected in: Missouri	Email:

**Matrix Types**

**Metals Analysis Types**

Air ( $\mu\text{g}/\text{m}^3$ )	Total Concentration of Lead	ICP-total concentration of metals (please list metals):
Wipe ( $\mu\text{g}/\text{ft}^2$ )	Total Concentration of RCRA 8 Metals	
Paint      Soil      Bulk ( $\mu\text{g/g}$ or ppm)	TCLP for Lead	
Other:	TCLP for RCRA 8 Metals	
Turn Around Time	Same Day	1 Day
	<input checked="" type="checkbox"/> Standard (5 day) <input type="checkbox"/> Full TCLP (10d)	2 days

Sample #	Collection Date & Time	Sample Identification/Location	Flow Rate	Start Time	Stop Time	Volume (L) Area (Sq ft)
110-2-2	2:56 PM	Concrete Floor - Lower Level				1 SF
110-2-3	2:58 PM	Top of Transformer				1 SF
FB-1	3:30 PM	Field Blank				
FB-2	3:30 PM	Field Blank				
FB-3	3:31 PM	Field Blank				
FB-4	3:31 PM	Field Blank				
FB-5	3:32 PM	Field Blank				
FB-6	3:32 PM	Field Blank				
FB-7	3:33 PM	Field Blank				
FB-8	3:34 PM	Field Blank				

Special Instructions	
----------------------	--

Relinquished by	Date	Time	Received by	Date	Time
(b) (6)	9-11-2017				

If no technician is provided, then the primary contact of your account will be selected. Unless scheduled, the turnaround time for all samples received after 3 pm will begin at 8 am the next business morning. Weekend or holiday work must be scheduled ahead of time and is charged at 150% of the Rush TAT rate. There is a minimum charge of \$100 for weekend work. A courier charge will be applied for same day and one-day turnaround times for offsite work. SanAir covers Standard Overnight FedEx shipping. Shipments billed to SanAir with a faster shipping rate will result in additional charges.

Page 4 of 6



# SanAir Technologies Laboratory, Inc

1551 Oakbridge Dr, Suite B Powhatan, VA 23139

804.897.1177 Toll Free 888.895.1177 Fax: 804.897.0070

[www.sanair.com](http://www.sanair.com)

SanAir ID Number

17035951

Final Report

**Name:** Occu-Tec  
**Address:** 100 NW Business Park lane  
Riverside, MO 64150

**Project Number:** 917004.002  
**P.O. Number:**  
**Project Name:** Electrical Vault Wipe Sampling

**Collected Date:** 9/7/2017  
**Received Date:** 9/12/2017 9:45 AM  
**Report Date:** 9/19/2017 1:30PM  
**Analyst :** C. Peterson

## Analytes Requested: RCRA 7 Metals

Test Method: EPA M3050B/6010C

## REPORT OF ANALYSIS

Lab Sample #	Field Sample #	Analyte	Sample Description	Results in ug/Ft <sup>2</sup>	MRL ug/Sample
17035951-01	103-1-1	Silver (Ag)	Vault Floor - Upper Level	<2.5	2.5
		Arsenic (As)		<2.5	2.5
		Barium (Ba)		270	2.5
		Cadmium (Cd)		5.70	2.5
		Chromium (Cr)		28.0	2.5
		Lead (Pb)		234	2.5
		Selenium (Se)		<2.5	2.5
17035951-02	103-1-2	Silver (Ag)	Top Of Cabinet - Upper Level	<2.5	2.5
		Arsenic (As)		<2.5	2.5
		Barium (Ba)		68.0	2.5
		Cadmium (Cd)		5.48	2.5
		Chromium (Cr)		5.20	2.5
		Lead (Pb)		183	2.5
		Selenium (Se)		<2.5	2.5
17035951-03	103-1-3	Silver (Ag)	Vault Floor- Lower Level	5.20	2.5
		Arsenic (As)		11.3	2.5
		Barium (Ba)		243	2.5
		Cadmium (Cd)		9.60	2.5
		Chromium (Cr)		54.4	2.5
		Lead (Pb)		609	2.5
		Selenium (Se)		12.8	2.5

MRL: Method Reporting Limit based on 2.5ug

### Certification

SanAir Technologies Laboratory, Inc participates in the certification for environmental Lead as administered by AIHA-ELLAP (Lab Id 162952) and the State of New York-ELAP (Lab Id 11983, and has met the EPA's NLLAP program standards.

Signature: (b) (6)

Date: 9/13/2017

Reviewed: (b) (6)

Date: 9/19/2017

**Analytes Requested: RCRA 7 Metals****Test Method: EPA M3050B/6010C****REPORT OF ANALYSIS**

<b>Lab Sample #</b>	<b>Field Sample #</b>	<b>Analyte</b>	<b>Sample Description</b>	<b>Results in ug/Ft<sup>2</sup></b>	<b>MRL ug/Sample</b>
17035951-04	103-1-4	Silver (Ag)	Cabinet Lower Level	<2.5	2.5
		Arsenic (As)		<2.5	2.5
		Barium (Ba)		182	2.5
		Cadmium (Cd)		10.6	2.5
		Chromium (Cr)		18.5	2.5
		Lead (Pb)		477	2.5
		Selenium (Se)		2.69	2.5
17035951-05	103-2-1	Silver (Ag)	Vault Floor Concrete - Upper Level	<2.5	2.5
		Arsenic (As)		<2.5	2.5
		Barium (Ba)		71.0	2.5
		Cadmium (Cd)		<2.5	2.5
		Chromium (Cr)		8.05	2.5
		Lead (Pb)		60.3	2.5
		Selenium (Se)		<2.5	2.5
17035951-06	103-2-2	Silver (Ag)	Switch Board #506349 - Upper Level	<2.5	2.5
		Arsenic (As)		<2.5	2.5
		Barium (Ba)		213	2.5
		Cadmium (Cd)		13.7	2.5
		Chromium (Cr)		20.1	2.5
		Lead (Pb)		1,690	2.5
		Selenium (Se)		4.90	2.5
17035951-07	103-2-3	Silver (Ag)	Vault Floor Concrete - Lower Level	2.60	2.5
		Arsenic (As)		<2.5	2.5
		Barium (Ba)		160	2.5
		Cadmium (Cd)		4.30	2.5
		Chromium (Cr)		27.1	2.5
		Lead (Pb)		116	2.5
		Selenium (Se)		4.37	2.5
17035951-08	103-2-4	Silver (Ag)	Switch Gear (Face) - Lower Level	<2.5	2.5
		Arsenic (As)		<2.5	2.5
		Barium (Ba)		11.6	2.5
		Cadmium (Cd)		<2.5	2.5
		Chromium (Cr)		<2.5	2.5
		Lead (Pb)		12.1	2.5
		Selenium (Se)		<2.5	2.5

MRL: Method Reporting Limit based on 2.5ug

**Certification**

SanAir Technologies Laboratory, Inc participates in the certification for environmental Lead as administered by AIHA-ELLAP (Lab Id 162952) and the State of New York-ELAP (Lab Id 11983, and has met the EPA's NLLAP program standards.

Signature: (b) (6)

Date: 9/13/2017

Reviewed: (b) (6)

Date: 9/19/2017

**Analytes Requested: RCRA 7 Metals****Test Method: EPA M3050B/6010C****REPORT OF ANALYSIS**

<b>Lab Sample #</b>	<b>Field Sample #</b>	<b>Analyte</b>	<b>Sample Description</b>	<b>Results in ug/Ft<sup>2</sup></b>	<b>MRL ug/Sample</b>
17035951-09	103-3-1	Silver (Ag)	Top Of Duct SW Side - Upper Level	<2.5	2.5
		Arsenic (As)		<2.5	2.5
		Barium (Ba)		330	2.5
		Cadmium (Cd)		17.6	2.5
		Chromium (Cr)		23.4	2.5
		Lead (Pb)		203	2.5
		Selenium (Se)		4.80	2.5
17035951-10	103-3-2	Silver (Ag)	Vault Floor - Lower Level	<2.5	2.5
		Arsenic (As)		<2.5	2.5
		Barium (Ba)		108	2.5
		Cadmium (Cd)		5.90	2.5
		Chromium (Cr)		32.3	2.5
		Lead (Pb)		145	2.5
		Selenium (Se)		4.80	2.5
17035951-11	103-3-3	Silver (Ag)	Transformer #508900 - Lower Level	<2.5	2.5
		Arsenic (As)		<2.5	2.5
		Barium (Ba)		132	2.5
		Cadmium (Cd)		5.34	2.5
		Chromium (Cr)		16.7	2.5
		Lead (Pb)		98.0	2.5
		Selenium (Se)		<2.5	2.5
17035951-12	103-4-1	Silver (Ag)	Vault Floor Concrete - Upper Level	<2.5	2.5
		Arsenic (As)		<2.5	2.5
		Barium (Ba)		62.0	2.5
		Cadmium (Cd)		3.80	2.5
		Chromium (Cr)		13.3	2.5
		Lead (Pb)		94.3	2.5
		Selenium (Se)		<2.5	2.5
17035951-13	103-4-2	Silver (Ag)	Dry Transformer #500848	<2.5	2.5
		Arsenic (As)		2.90	2.5
		Barium (Ba)		330	2.5
		Cadmium (Cd)		23.0	2.5
		Chromium (Cr)		26.0	2.5
		Lead (Pb)		225	2.5
		Selenium (Se)		5.26	2.5

MRL: Method Reporting Limit based on 2.5ug

**Certification**

SanAir Technologies Laboratory, Inc participates in the certification for environmental Lead as administered by AIHA-ELLAP (Lab Id 162952) and the State of New York-ELAP (Lab Id 11983, and has met the EPA's NLLAP program standards.

Signature: (b) (6)

Date: 9/13/2017

Reviewed: (b) (6)

Date: 9/19/2017

**Analytes Requested: RCRA 7 Metals****Test Method: EPA M3050B/6010C****REPORT OF ANALYSIS**

<b>Lab Sample #</b>	<b>Field Sample #</b>	<b>Analyte</b>	<b>Sample Description</b>	<b>Results in ug/Ft<sup>2</sup></b>	<b>MRL ug/Sample</b>
17035951-14	103-4-3	Silver (Ag)	Dry Transformer #500848	<2.5	2.5
		Arsenic (As)		3.30	2.5
		Barium (Ba)		182	2.5
		Cadmium (Cd)		18.0	2.5
		Chromium (Cr)		46.0	2.5
		Lead (Pb)		360	2.5
		Selenium (Se)		6.25	2.5
17035951-15	103F-1-1	Silver (Ag)	Top Of Transformer - Lower Level	<2.5	2.5
		Arsenic (As)		<2.5	2.5
		Barium (Ba)		120	2.5
		Cadmium (Cd)		2.64	2.5
		Chromium (Cr)		11.0	2.5
		Lead (Pb)		63.2	2.5
		Selenium (Se)		<2.5	2.5
17035951-16	103F-1-2	Silver (Ag)	Concrete Floor - Lower Level	3.53	2.5
		Arsenic (As)		<2.5	2.5
		Barium (Ba)		129	2.5
		Cadmium (Cd)		4.80	2.5
		Chromium (Cr)		23.3	2.5
		Lead (Pb)		445	2.5
		Selenium (Se)		3.00	2.5
17035951-17	103F-1-3	Silver (Ag)	Transformer (Face) - Lower Level	<2.5	2.5
		Arsenic (As)		<2.5	2.5
		Barium (Ba)		8.10	2.5
		Cadmium (Cd)		<2.5	2.5
		Chromium (Cr)		5.56	2.5
		Lead (Pb)		12.4	2.5
		Selenium (Se)		<2.5	2.5
17035951-18	104-1-1	Silver (Ag)	Metal Floor - Upper Level	<2.5	2.5
		Arsenic (As)		<2.5	2.5
		Barium (Ba)		104	2.5
		Cadmium (Cd)		<2.5	2.5
		Chromium (Cr)		10.6	2.5
		Lead (Pb)		104	2.5
		Selenium (Se)		<2.5	2.5

MRL: Method Reporting Limit based on 2.5ug

**Certification**

SanAir Technologies Laboratory, Inc participates in the certification for environmental Lead as administered by AIHA-ELLAP (Lab Id 162952) and the State of New York-ELAP (Lab Id 11983, and has met the EPA's NLLAP program standards.

Signature: (b) (6)

Date: 9/13/2017

Reviewed: (b) (6)

Date: 9/19/2017

**Analytes Requested: RCRA 7 Metals****Test Method: EPA M3050B/6010C****REPORT OF ANALYSIS**

<b>Lab Sample #</b>	<b>Field Sample #</b>	<b>Analyte</b>	<b>Sample Description</b>	<b>Results in ug/Ft<sup>2</sup></b>	<b>MRL ug/Sample</b>
17035951-19	104-1-2	Silver (Ag)	Dry Transformer - Upper Level	<2.5	2.5
		Arsenic (As)		<2.5	2.5
		Barium (Ba)		190	2.5
		Cadmium (Cd)		<2.5	2.5
		Chromium (Cr)		21.3	2.5
		Lead (Pb)		125	2.5
		Selenium (Se)		3.63	2.5
17035951-20	104-1-3	Silver (Ag)	Vault Concrete Floor - Lower Level	7.03	2.5
		Arsenic (As)		9.90	2.5
		Barium (Ba)		412	2.5
		Cadmium (Cd)		45.0	2.5
		Chromium (Cr)		68.0	2.5
		Lead (Pb)		810	2.5
		Selenium (Se)		<2.5	2.5
17035951-21	104-1-4	Silver (Ag)	Switchgear 4AB - Lower Level	<2.5	2.5
		Arsenic (As)		<2.5	2.5
		Barium (Ba)		115	2.5
		Cadmium (Cd)		7.10	2.5
		Chromium (Cr)		17.4	2.5
		Lead (Pb)		94.0	2.5
		Selenium (Se)		<2.5	2.5
17035951-22	104-2-1	Silver (Ag)	Metal Floor - Upper Level	<2.5	2.5
		Arsenic (As)		<2.5	2.5
		Barium (Ba)		97.0	2.5
		Cadmium (Cd)		<2.5	2.5
		Chromium (Cr)		15.2	2.5
		Lead (Pb)		94.7	2.5
		Selenium (Se)		3.40	2.5
17035951-23	104-2-2	Silver (Ag)	Concrete Floor - Lower Level	4.00	2.5
		Arsenic (As)		6.26	2.5
		Barium (Ba)		254	2.5
		Cadmium (Cd)		5.50	2.5
		Chromium (Cr)		67.2	2.5
		Lead (Pb)		450	2.5
		Selenium (Se)		10.4	2.5

MRL: Method Reporting Limit based on 2.5ug

**Certification**

SanAir Technologies Laboratory, Inc participates in the certification for environmental Lead as administered by AIHA-ELLAP (Lab Id 162952) and the State of New York-ELAP (Lab Id 11983, and has met the EPA's NLLAP program standards.

Signature: (b) (6)

Date: 9/14/2017

Reviewed: (b) (6)

Date: 9/19/2017

**Analytes Requested: RCRA 7 Metals****Test Method: EPA M3050B/6010C****REPORT OF ANALYSIS**

Lab Sample #	Field Sample #	Analyte	Sample Description	Results in ug/Ft <sup>2</sup>	MRL ug/Sample
17035951-24	104-2-3	Silver (Ag)	Transformer - Lower Level	<2.5	2.5
		Arsenic (As)		<2.5	2.5
		Barium (Ba)		50.3	2.5
		Cadmium (Cd)		<2.5	2.5
		Chromium (Cr)		6.40	2.5
		Lead (Pb)		70.0	2.5
		Selenium (Se)		<2.5	2.5
17035951-25	104-2-4	Silver (Ag)	Concrete Floor North Side - Lower Level	7.42	2.5
		Arsenic (As)		8.90	2.5
		Barium (Ba)		380	2.5
		Cadmium (Cd)		9.14	2.5
		Chromium (Cr)		63.0	2.5
		Lead (Pb)		256	2.5
		Selenium (Se)		20.2	2.5
17035951-26	104-3-1	Silver (Ag)	Dry Transformer - Upper Level	5.50	2.5
		Arsenic (As)		2.50	2.5
		Barium (Ba)		190	2.5
		Cadmium (Cd)		4.50	2.5
		Chromium (Cr)		25.3	2.5
		Lead (Pb)		160	2.5
		Selenium (Se)		4.60	2.5
17035951-27	104-3-2	Silver (Ag)	Concrete Floor - Lower Level	<2.5	2.5
		Arsenic (As)		<2.5	2.5
		Barium (Ba)		90.0	2.5
		Cadmium (Cd)		<2.5	2.5
		Chromium (Cr)		12.7	2.5
		Lead (Pb)		99.5	2.5
		Selenium (Se)		<2.5	2.5
17035951-28	104-3-3	Silver (Ag)	Power Pannel Board - Lower Level	<2.5	2.5
		Arsenic (As)		<2.5	2.5
		Barium (Ba)		81.1	2.5
		Cadmium (Cd)		<2.5	2.5
		Chromium (Cr)		31.2	2.5
		Lead (Pb)		200	2.5
		Selenium (Se)		<2.5	2.5

MRL: Method Reporting Limit based on 2.5ug

**Certification**

SanAir Technologies Laboratory, Inc participates in the certification for environmental Lead as administered by AIHA-ELLAP (Lab Id 162952) and the State of New York-ELAP (Lab Id 11983, and has met the EPA's NLLAP program standards.

Signature: (b) (6)

Date: 9/14/2017

Reviewed: (b) (6)

Date: 9/19/2017

**Analytes Requested: RCRA 7 Metals****Test Method: EPA M3050B/6010C****REPORT OF ANALYSIS**

<b>Lab Sample #</b>	<b>Field Sample #</b>	<b>Analyte</b>	<b>Sample Description</b>	<b>Results in ug/Ft<sup>2</sup></b>	<b>MRL ug/Sample</b>
17035951-29	104-4-1	Silver (Ag)	Dry Transformer - Upper Level	<2.5	2.5
		Arsenic (As)		<2.5	2.5
		Barium (Ba)		70.5	2.5
		Cadmium (Cd)		93.5	2.5
		Chromium (Cr)		9.82	2.5
		Lead (Pb)		78.6	2.5
		Selenium (Se)		<2.5	2.5
17035951-30	104-4-2	Silver (Ag)	Concrete Floor - Upper Level	<2.5	2.5
		Arsenic (As)		<2.5	2.5
		Barium (Ba)		183	2.5
		Cadmium (Cd)		4.16	2.5
		Chromium (Cr)		52.6	2.5
		Lead (Pb)		392	2.5
		Selenium (Se)		4.40	2.5
17035951-31	104-4-3	Silver (Ag)	Transformer - Lower Level	<2.5	2.5
		Arsenic (As)		3.33	2.5
		Barium (Ba)		185	2.5
		Cadmium (Cd)		3.35	2.5
		Chromium (Cr)		50.3	2.5
		Lead (Pb)		400	2.5
		Selenium (Se)		7.90	2.5
17035951-32	104-5-1	Silver (Ag)	Dry Transformer - Upper Level	<2.5	2.5
		Arsenic (As)		<2.5	2.5
		Barium (Ba)		200	2.5
		Cadmium (Cd)		1.90	2.5
		Chromium (Cr)		11.0	2.5
		Lead (Pb)		76.3	2.5
		Selenium (Se)		<2.5	2.5
17035951-33	104-5-2	Silver (Ag)	Metal Floor - Upper Level	<2.5	2.5
		Arsenic (As)		<2.5	2.5
		Barium (Ba)		107	2.5
		Cadmium (Cd)		5.20	2.5
		Chromium (Cr)		13.5	2.5
		Lead (Pb)		263	2.5
		Selenium (Se)		<2.5	2.5

MRL: Method Reporting Limit based on 2.5ug

**Certification**

SanAir Technologies Laboratory, Inc participates in the certification for environmental Lead as administered by AIHA-ELLAP (Lab Id 162952) and the State of New York-ELAP (Lab Id 11983, and has met the EPA's NLLAP program standards.

Signature: (b) (6)

Date: 9/14/2017

Reviewed: (b) (6)

Date: 9/19/2017

**Analytes Requested: RCRA 7 Metals****Test Method: EPA M3050B/6010C****REPORT OF ANALYSIS**

Lab Sample #	Field Sample #	Analyte	Sample Description	Results in ug/Ft <sup>2</sup>	MRL ug/Sample
17035951-34	104-5-3	Silver (Ag)	Concrete Floor - Lower Level	<2.5	2.5
		Arsenic (As)		6.54	2.5
		Barium (Ba)		231	2.5
		Cadmium (Cd)		11.2	2.5
		Chromium (Cr)		39.6	2.5
		Lead (Pb)		708	2.5
		Selenium (Se)		7.80	2.5
17035951-35	105-1-1	Silver (Ag)	Metal Floor - Upper Level	<2.5	2.5
		Arsenic (As)		4.70	2.5
		Barium (Ba)		450	2.5
		Cadmium (Cd)		4.15	2.5
		Chromium (Cr)		42.0	2.5
		Lead (Pb)		325	2.5
		Selenium (Se)		5.73	2.5
17035951-36	105-1-2	Silver (Ag)	Transformer - Upper Level	<2.5	2.5
		Arsenic (As)		11.7	2.5
		Barium (Ba)		176	2.5
		Cadmium (Cd)		20.4	2.5
		Chromium (Cr)		61.3	2.5
		Lead (Pb)		408	2.5
		Selenium (Se)		15.3	2.5
17035951-37	105-1-3	Silver (Ag)	Transformer - Lower Level	<2.5	2.5
		Arsenic (As)		20.7	2.5
		Barium (Ba)		394	2.5
		Cadmium (Cd)		10.5	2.5
		Chromium (Cr)		330	2.5
		Lead (Pb)		3,360	2.5
		Selenium (Se)		36.5	2.5
17035951-38	105-1-4	Silver (Ag)	Concrete Floor - Lower Level	<2.5	2.5
		Arsenic (As)		4.17	2.5
		Barium (Ba)		261	2.5
		Cadmium (Cd)		8.10	2.5
		Chromium (Cr)		33.7	2.5
		Lead (Pb)		260	2.5
		Selenium (Se)		5.20	2.5

MRL: Method Reporting Limit based on 2.5ug

**Certification**

SanAir Technologies Laboratory, Inc participates in the certification for environmental Lead as administered by AIHA-ELLAP (Lab Id 162952) and the State of New York-ELAP (Lab Id 11983, and has met the EPA's NLLAP program standards.

Signature:

(b) (6)

Date: 9/14/2017

Reviewed:

(b) (6)

Date: 9/19/2017

**Analytes Requested: RCRA 7 Metals****Test Method: EPA M3050B/6010C****REPORT OF ANALYSIS**

<b>Lab Sample #</b>	<b>Field Sample #</b>	<b>Analyte</b>	<b>Sample Description</b>	<b>Results in ug/Ft<sup>2</sup></b>	<b>MRL ug/Sample</b>
17035951-39	105-2-1	Silver (Ag)	Concrete Floor - Upper Level	3.40	2.5
		Arsenic (As)		8.90	2.5
		Barium (Ba)		620	2.5
		Cadmium (Cd)		3.40	2.5
		Chromium (Cr)		47.4	2.5
		Lead (Pb)		844	2.5
		Selenium (Se)		5.02	2.5
17035951-40	105-2-2	Silver (Ag)	Transformer - Lower Level	<2.5	2.5
		Arsenic (As)		10.3	2.5
		Barium (Ba)		80.8	2.5
		Cadmium (Cd)		6.45	2.5
		Chromium (Cr)		106	2.5
		Lead (Pb)		7,300	2.5
		Selenium (Se)		15.0	2.5
17035951-41	105-2-3	Silver (Ag)	Concrete Floor - Lower Level	<2.5	2.5
		Arsenic (As)		6.00	2.5
		Barium (Ba)		240	2.5
		Cadmium (Cd)		6.20	2.5
		Chromium (Cr)		33.0	2.5
		Lead (Pb)		243	2.5
		Selenium (Se)		9.46	2.5
17035951-42	105-3-1	Silver (Ag)	Dry Transformer - Upper Level	<2.5	2.5
		Arsenic (As)		<2.5	2.5
		Barium (Ba)		384	2.5
		Cadmium (Cd)		4.48	2.5
		Chromium (Cr)		11.3	2.5
		Lead (Pb)		98.4	2.5
		Selenium (Se)		<2.5	2.5
17035951-43	105-3-2	Silver (Ag)	Metal Floor - Upper Level	<2.5	2.5
		Arsenic (As)		4.70	2.5
		Barium (Ba)		353	2.5
		Cadmium (Cd)		21.5	2.5
		Chromium (Cr)		46.0	2.5
		Lead (Pb)		555	2.5
		Selenium (Se)		7.50	2.5

MRL: Method Reporting Limit based on 2.5ug

**Certification**

SanAir Technologies Laboratory, Inc participates in the certification for environmental Lead as administered by AIHA-ELLAP (Lab Id 162952) and the State of New York-ELAP (Lab Id 11983, and has met the EPA's NLLAP program standards.

Signature: (b) (6)

Date: 9/14/2017

Reviewed: (b) (6)

Date: 9/19/2017

**Analytes Requested: RCRA 7 Metals****Test Method: EPA M3050B/6010C****REPORT OF ANALYSIS**

<b>Lab Sample #</b>	<b>Field Sample #</b>	<b>Analyte</b>	<b>Sample Description</b>	<b>Results in ug/Ft<sup>2</sup></b>	<b>MRL ug/Sample</b>
17035951-44	105-3-3	Silver (Ag)	Transformer (Face) - Lower Level	<2.5	2.5
		Arsenic (As)		<2.5	2.5
		Barium (Ba)		15.0	2.5
		Cadmium (Cd)		<2.5	2.5
		Chromium (Cr)		<2.5	2.5
		Lead (Pb)		16.0	2.5
		Selenium (Se)		<2.5	2.5
17035951-45	105-3-4	Silver (Ag)	Concrete Floor - Lower Level	8.80	2.5
		Arsenic (As)		3.15	2.5
		Barium (Ba)		254	2.5
		Cadmium (Cd)		105	2.5
		Chromium (Cr)		42.4	2.5
		Lead (Pb)		360	2.5
		Selenium (Se)		5.41	2.5
17035951-46	105-4-1	Silver (Ag)	Transformer - Upper Level	<2.5	2.5
		Arsenic (As)		3.20	2.5
		Barium (Ba)		278	2.5
		Cadmium (Cd)		3.80	2.5
		Chromium (Cr)		28.4	2.5
		Lead (Pb)		252	2.5
		Selenium (Se)		4.64	2.5
17035951-47	105-4-2	Silver (Ag)	Concrete Floor - Upper Level	<2.5	2.5
		Arsenic (As)		<2.5	2.5
		Barium (Ba)		273	2.5
		Cadmium (Cd)		8.40	2.5
		Chromium (Cr)		64.5	2.5
		Lead (Pb)		10,370	2.5
		Selenium (Se)		3.82	2.5
17035951-48	105-4-3	Silver (Ag)	Transformer - Lower Level	<2.5	2.5
		Arsenic (As)		4.80	2.5
		Barium (Ba)		260	2.5
		Cadmium (Cd)		13.0	2.5
		Chromium (Cr)		73.7	2.5
		Lead (Pb)		1,250	2.5
		Selenium (Se)		10.5	2.5

MRL: Method Reporting Limit based on 2.5ug

**Certification**

SanAir Technologies Laboratory, Inc participates in the certification for environmental Lead as administered by AIHA-ELLAP (Lab Id 162952) and the State of New York-ELAP (Lab Id 11983, and has met the EPA's NLLAP program standards.

Signature: (b) (6)

Reviewed: (b) (6)

Date: 9/14/2017

Date: 9/19/2017

**Analytes Requested: RCRA 7 Metals****Test Method: EPA M3050B/6010C****REPORT OF ANALYSIS**

<b>Lab Sample #</b>	<b>Field Sample #</b>	<b>Analyte</b>	<b>Sample Description</b>	<b>Results in ug/Ft<sup>2</sup></b>	<b>MRL ug/Sample</b>
17035951-49	105-5-1	Silver (Ag)	Metal Floor - Upper Level	<2.5	2.5
		Arsenic (As)		3.24	2.5
		Barium (Ba)		550	2.5
		Cadmium (Cd)		12.3	2.5
		Chromium (Cr)		35.8	2.5
		Lead (Pb)		340	2.5
		Selenium (Se)		4.90	2.5
17035951-50	105-5-2	Silver (Ag)	Transformer - Lower Level	<2.5	2.5
		Arsenic (As)		3.78	2.5
		Barium (Ba)		740	2.5
		Cadmium (Cd)		3.65	2.5
		Chromium (Cr)		54.0	2.5
		Lead (Pb)		149	2.5
		Selenium (Se)		5.45	2.5
17035951-51	105-5-3	Silver (Ag)	Concrete Floor - Lower Level	<2.5	2.5
		Arsenic (As)		9.33	2.5
		Barium (Ba)		435	2.5
		Cadmium (Cd)		4.30	2.5
		Chromium (Cr)		110	2.5
		Lead (Pb)		212	2.5
		Selenium (Se)		8.30	2.5
17035951-52	105-6-1	Silver (Ag)	Concrete Floor - Upper Level	<2.5	2.5
		Arsenic (As)		<2.5	2.5
		Barium (Ba)		125	2.5
		Cadmium (Cd)		2.94	2.5
		Chromium (Cr)		16.8	2.5
		Lead (Pb)		140	2.5
		Selenium (Se)		4.18	2.5
17035951-53	105-6-2	Silver (Ag)	Concrete Floor - Lower Level	5.48	2.5
		Arsenic (As)		<2.5	2.5
		Barium (Ba)		168	2.5
		Cadmium (Cd)		4.03	2.5
		Chromium (Cr)		22.7	2.5
		Lead (Pb)		195	2.5
		Selenium (Se)		3.80	2.5

MRL: Method Reporting Limit based on 2.5ug

**Certification**

SanAir Technologies Laboratory, Inc participates in the certification for environmental Lead as administered by AIHA-ELLAP (Lab Id 162952) and the State of New York-ELAP (Lab Id 11983, and has met the EPA's NLLAP program standards.

Signature: (b) (6)

Date: 9/14/2017

Reviewed: (b) (6)

Date: 9/19/2017

**Analytes Requested: RCRA 7 Metals****Test Method: EPA M3050B/6010C****REPORT OF ANALYSIS**

<b>Lab Sample #</b>	<b>Field Sample #</b>	<b>Analyte</b>	<b>Sample Description</b>	<b>Results in ug/Ft<sup>2</sup></b>	<b>MRL ug/Sample</b>
17035951-54	105-6-3	Silver (Ag)	Transformer - Lower Level	<2.5	2.5
		Arsenic (As)		<2.5	2.5
		Barium (Ba)		20.8	2.5
		Cadmium (Cd)		<2.5	2.5
		Chromium (Cr)		<2.5	2.5
		Lead (Pb)		13.0	2.5
		Selenium (Se)		<2.5	2.5
17035951-55	107-1-1	Silver (Ag)	Transformer - Lower Level	<2.5	2.5
		Arsenic (As)		<2.5	2.5
		Barium (Ba)		36.7	2.5
		Cadmium (Cd)		<2.5	2.5
		Chromium (Cr)		<2.5	2.5
		Lead (Pb)		6.16	2.5
		Selenium (Se)		<2.5	2.5
17035951-56	107-1-2	Silver (Ag)	Concrete Floor - Lower Level	<2.5	2.5
		Arsenic (As)		<2.5	2.5
		Barium (Ba)		31.5	2.5
		Cadmium (Cd)		<2.5	2.5
		Chromium (Cr)		9.65	2.5
		Lead (Pb)		50.0	2.5
		Selenium (Se)		4.30	2.5
17035951-57	107-1-3	Silver (Ag)	Concrete Floor - Lower Level SW Side	<2.5	2.5
		Arsenic (As)		<2.5	2.5
		Barium (Ba)		35.6	2.5
		Cadmium (Cd)		<2.5	2.5
		Chromium (Cr)		5.60	2.5
		Lead (Pb)		33.4	2.5
		Selenium (Se)		<2.5	2.5
17035951-58	107-1-4	Silver (Ag)	Transformer (Face) - Lower Level	<2.5	2.5
		Arsenic (As)		<2.5	2.5
		Barium (Ba)		3.24	2.5
		Cadmium (Cd)		<2.5	2.5
		Chromium (Cr)		<2.5	2.5
		Lead (Pb)		<2.5	2.5
		Selenium (Se)		<2.5	2.5

MRL: Method Reporting Limit based on 2.5ug

**Certification**

SanAir Technologies Laboratory, Inc participates in the certification for environmental Lead as administered by AIHA-ELLAP (Lab Id 162952) and the State of New York-ELAP (Lab Id 11983, and has met the EPA's NLLAP program standards.

(b) (6)

Signature:

Date: 9/14/2017

(b) (6)

Reviewed:

Date: 9/19/2017

**Analytes Requested: RCRA 7 Metals****Test Method: EPA M3050B/6010C****REPORT OF ANALYSIS**

Lab Sample #	Field Sample #	Analyte	Sample Description	Results in ug/Ft <sup>2</sup>	MRL ug/Sample
17035951-59	108A-1-1	Silver (Ag)	Concrete Floor West Side	<2.5	2.5
		Arsenic (As)		<2.5	2.5
		Barium (Ba)		330	2.5
		Cadmium (Cd)		4.00	2.5
		Chromium (Cr)		21.5	2.5
		Lead (Pb)		527	2.5
		Selenium (Se)		3.75	2.5
17035951-60	108A-1-2	Silver (Ag)	East Side Of Containment Floor For TR-1	<2.5	2.5
		Arsenic (As)		3.22	2.5
		Barium (Ba)		185	2.5
		Cadmium (Cd)		<2.5	2.5
		Chromium (Cr)		62.5	2.5
		Lead (Pb)		1,024	2.5
		Selenium (Se)		3.00	2.5
17035951-61	108A-1-3	Silver (Ag)	South Side Face Of TR-2	<2.5	2.5
		Arsenic (As)		<2.5	2.5
		Barium (Ba)		11.0	2.5
		Cadmium (Cd)		<2.5	2.5
		Chromium (Cr)		<2.5	2.5
		Lead (Pb)		200	2.5
		Selenium (Se)		<2.5	2.5
17035951-62	108A-1-4	Silver (Ag)	Top Of 4 Phase Relay	<2.5	2.5
		Arsenic (As)		3.50	2.5
		Barium (Ba)		211	2.5
		Cadmium (Cd)		36.0	2.5
		Chromium (Cr)		20.7	2.5
		Lead (Pb)		314	2.5
		Selenium (Se)		4.92	2.5
17035951-63	108B-1-1	Silver (Ag)	Top Of 4 Phase Relay	<2.5	2.5
		Arsenic (As)		3.74	2.5
		Barium (Ba)		144	2.5
		Cadmium (Cd)		7.10	2.5
		Chromium (Cr)		31.7	2.5
		Lead (Pb)		780	2.5
		Selenium (Se)		4.00	2.5

MRL: Method Reporting Limit based on 2.5ug

**Certification**

SanAir Technologies Laboratory, Inc participates in the certification for environmental Lead as administered by AIHA-ELLAP (Lab Id 162952) and the State of New York-ELAP (Lab Id 11983, and has met the EPA's NLLAP program standards.

(b) (6)

Signature:

Date: 9/14/2017

(b) (6)

Reviewed:

Date: 9/19/2017

**Analytes Requested: RCRA 7 Metals****Test Method: EPA M3050B/6010C****REPORT OF ANALYSIS**

<b>Lab Sample #</b>	<b>Field Sample #</b>	<b>Analyte</b>	<b>Sample Description</b>	<b>Results in ug/Ft<sup>2</sup></b>	<b>MRL ug/Sample</b>
17035951-64	108B-1-2	Silver (Ag)	Below TR-2 Middle Of Building	<2.5	2.5
		Arsenic (As)		<2.5	2.5
		Barium (Ba)		210	2.5
		Cadmium (Cd)		<2.5	2.5
		Chromium (Cr)		46.5	2.5
		Lead (Pb)		4,860	2.5
		Selenium (Se)		3.15	2.5
17035951-65	108B-1-3	Silver (Ag)	Concrete Floor NE Side	<2.5	2.5
		Arsenic (As)		<2.5	2.5
		Barium (Ba)		470	2.5
		Cadmium (Cd)		5.90	2.5
		Chromium (Cr)		22.0	2.5
		Lead (Pb)		490	2.5
		Selenium (Se)		<2.5	2.5
17035951-66	108B-1-4	Silver (Ag)	North Face Of TR-1	<2.5	2.5
		Arsenic (As)		<2.5	2.5
		Barium (Ba)		18.7	2.5
		Cadmium (Cd)		<2.5	2.5
		Chromium (Cr)		<2.5	2.5
		Lead (Pb)		145	2.5
		Selenium (Se)		<2.5	2.5
17035951-67	110-1-1	Silver (Ag)	Metal Floor - Upper Level	<2.5	2.5
		Arsenic (As)		<2.5	2.5
		Barium (Ba)		70.4	2.5
		Cadmium (Cd)		3.64	2.5
		Chromium (Cr)		9.56	2.5
		Lead (Pb)		183	2.5
		Selenium (Se)		<2.5	2.5
17035951-68	110-1-2	Silver (Ag)	Concrete Floor - Lower Level	<2.5	2.5
		Arsenic (As)		<2.5	2.5
		Barium (Ba)		70.6	2.5
		Cadmium (Cd)		2.90	2.5
		Chromium (Cr)		9.70	2.5
		Lead (Pb)		165	2.5
		Selenium (Se)		<2.5	2.5

MRL: Method Reporting Limit based on 2.5ug

**Certification**

SanAir Technologies Laboratory, Inc participates in the certification for environmental Lead as administered by AIHA-ELLAP (Lab Id 162952) and the State of New York-ELAP (Lab Id 11983, and has met the EPA's NLLAP program standards.

Signature:

(b) (6)

Reviewed:

(b) (6)

Date: 9/14/2017

Date: 9/19/2017

**Analytes Requested: RCRA 7 Metals**

## REPORT OF ANALYSIS

Lab Sample #	Field Sample #	Analyte	Sample Description	Results in ug/Ft <sup>2</sup>	MRL ug/Sample
17035951-69	110-1-3	Silver (Ag)	Transformer - Lower Level	<2.5	2.5
		Arsenic (As)		<2.5	2.5
		Barium (Ba)		52.3	2.5
		Cadmium (Cd)		<2.5	2.5
		Chromium (Cr)		3.52	2.5
		Lead (Pb)		42.6	2.5
		Selenium (Se)		<2.5	2.5
17035951-70	110-2-1	Silver (Ag)	Metal Floor - Upper Level	<2.5	2.5
		Arsenic (As)		5.25	2.5
		Barium (Ba)		284	2.5
		Cadmium (Cd)		5.38	2.5
		Chromium (Cr)		91.0	2.5
		Lead (Pb)		3,210	2.5
		Selenium (Se)		8.00	2.5
17035951-71	110-2-2	Silver (Ag)	Concrete Floor - Lower Level	<2.5	2.5
		Arsenic (As)		<2.5	2.5
		Barium (Ba)		122	2.5
		Cadmium (Cd)		3.13	2.5
		Chromium (Cr)		19.8	2.5
		Lead (Pb)		233	2.5
		Selenium (Se)		<2.5	2.5
17035951-72	110-2-3	Silver (Ag)	Top Of Transformer	<2.5	2.5
		Arsenic (As)		<2.5	2.5
		Barium (Ba)		120	2.5
		Cadmium (Cd)		<2.5	2.5
		Chromium (Cr)		9.40	2.5
		Lead (Pb)		105	2.5
		Selenium (Se)		<2.5	2.5
17035951-73	FB-1	Silver (Ag)	Field Blank	<2.5	2.5
		Arsenic (As)		<2.5	2.5
		Barium (Ba)		<2.5	2.5
		Cadmium (Cd)		<2.5	2.5
		Chromium (Cr)		<2.5	2.5
		Lead (Pb)		<2.5	2.5
		Selenium (Se)		<2.5	2.5

MRL: Method Reporting Limit based on 2.5ug

**Certification**

SanAir Technologies Laboratory, Inc participates in the certification for environmental Lead as administered by AIHA-ELLAP (Lab Id 162952) and the State of New York-ELAP (Lab Id 11983, and has met the EPA's NLLAP program standards.

Signature: (b) (6)

Date: 9/14/2017

Reviewed: (b) (6)

Date: 9/19/2017

**Analytes Requested: RCRA 7 Metals****Test Method: EPA M3050B/6010C****REPORT OF ANALYSIS**

<b>Lab Sample #</b>	<b>Field Sample #</b>	<b>Analyte</b>	<b>Sample Description</b>	<b>Results in ug/Ft<sup>2</sup></b>	<b>MRL ug/Sample</b>
17035951-74	FB-2	Silver (Ag)	Field Blank	<2.5	2.5
		Arsenic (As)		<2.5	2.5
		Barium (Ba)		<2.5	2.5
		Cadmium (Cd)		<2.5	2.5
		Chromium (Cr)		<2.5	2.5
		Lead (Pb)		<2.5	2.5
		Selenium (Se)		<2.5	2.5
17035951-75	FB-3	Silver (Ag)	Field Blank	<2.5	2.5
		Arsenic (As)		<2.5	2.5
		Barium (Ba)		<2.5	2.5
		Cadmium (Cd)		<2.5	2.5
		Chromium (Cr)		<2.5	2.5
		Lead (Pb)		<2.5	2.5
		Selenium (Se)		<2.5	2.5
17035951-76	FB-4	Silver (Ag)	Field Blank	<2.5	2.5
		Arsenic (As)		<2.5	2.5
		Barium (Ba)		<2.5	2.5
		Cadmium (Cd)		<2.5	2.5
		Chromium (Cr)		<2.5	2.5
		Lead (Pb)		<2.5	2.5
		Selenium (Se)		<2.5	2.5
17035951-77	FB-5	Silver (Ag)	Field Blank	<2.5	2.5
		Arsenic (As)		<2.5	2.5
		Barium (Ba)		<2.5	2.5
		Cadmium (Cd)		<2.5	2.5
		Chromium (Cr)		<2.5	2.5
		Lead (Pb)		<2.5	2.5
		Selenium (Se)		<2.5	2.5
17035951-78	FB-6	Silver (Ag)	Field Blank	<2.5	2.5
		Arsenic (As)		<2.5	2.5
		Barium (Ba)		<2.5	2.5
		Cadmium (Cd)		<2.5	2.5
		Chromium (Cr)		<2.5	2.5
		Lead (Pb)		<2.5	2.5
		Selenium (Se)		<2.5	2.5

MRL: Method Reporting Limit based on 2.5ug

**Certification**

SanAir Technologies Laboratory, Inc participates in the certification for environmental Lead as administered by AIHA-ELLAP (Lab Id 162952) and the State of New York-ELAP (Lab Id 11983, and has met the EPA's NLLAP program standards.

Signature: (b) (6)

Date: 9/14/2017

Reviewed: (b) (6)

Date: 9/19/2017

**Analytes Requested: RCRA 7 Metals****Test Method: EPA M3050B/6010C****REPORT OF ANALYSIS**

Lab Sample #	Field Sample #	Analyte	Sample Description	Results in ug/ft <sup>2</sup>	MRL ug/Sample
17035951-79	FB-7	Silver (Ag)	Field Blank	<2.5	2.5
		Arsenic (As)		<2.5	2.5
		Barium (Ba)		<2.5	2.5
		Cadmium (Cd)		<2.5	2.5
		Chromium (Cr)		<2.5	2.5
		Lead (Pb)		<2.5	2.5
		Selenium (Se)		<2.5	2.5
17035951-80	FB-8	Silver (Ag)	Field Blank	<2.5	2.5
		Arsenic (As)		<2.5	2.5
		Barium (Ba)		<2.5	2.5
		Cadmium (Cd)		<2.5	2.5
		Chromium (Cr)		<2.5	2.5
		Lead (Pb)		<2.5	2.5
		Selenium (Se)		<2.5	2.5

MRL: Method Reporting Limit based on 2.5ug

**Certification**

SanAir Technologies Laboratory, Inc participates in the certification for environmental Lead as administered by AIHA-ELLAP (Lab Id 162952) and the State of New York-ELAP (Lab Id 11983, and has met the EPA's NLLAP program standards.

Signature: (b) (6)

Reviewed: (b) (6)

Date: 9/14/2017

Date: 9/19/2017

30 µg/m<sup>3</sup> OSHA Action Level (8-hour time weighted average)  
 50 µg/m<sup>3</sup> OSHA Permissible Exposure Limit (General Industry)  
 50 µg/m<sup>3</sup> OSHA Permissible Exposure Limit (Construction)

## Dust

10 µg/ft<sup>2</sup> HUD Clearance Level for Floors  
 100 µg/ft<sup>2</sup> HUD Clearance Level for Interior Window Sills  
 100 µg/ft<sup>2</sup> HUD Clearance Level for Window Troughs  
 40 µg/ft<sup>2</sup> HUD Clearance Level for Porch Floors

## Water

15 ppb (µg/liter) EPA Maximum Containment Level

## Paint

0.5% by weight HUD definition of lead based paint  
 1.0 mg/cm<sup>2</sup>  
 5000 ppm

Soil

400 ppm HUD-Play areas and high-contact areas for children

TCLP EPA Limits:

Silver (Ag): 5.0 mg/L

Arsenic (As): 5.0 mg/L

Barium (Ba): 100 mg/L

Cadmium (Cd): 1.0 mg/L

Chromium (Cr): 5.0 mg/L

Mercury (Hg): 0.2 mg/L

Lead (Pb): 5.0 mg/L

Selenium (Se): 1.0 mg/L

# **Appendix**

## **D**

### Qualifications and Licenses

**STATE OF MISSOURI  
DEPARTMENT OF HEALTH AND SENIOR SERVICES**

**LEAD OCCUPATION LICENSE REGISTRATION**

Issued to:

**Justin E. Arnold**

The person, firm or corporation whose name appears on this certificate has fulfilled the requirements for licensure as set forth in the Missouri Revised Statutes 701.300-701.338, as long as not suspended or revoked, and is hereby authorized to engage in the activity listed below.

**Lead Risk Assessor**

Category of License

Issuance Date: **6/11/2016**

Expiration Date: **6/11/2018**

License Number: **120611-300003622**



(b) (6)

Peter Lyskowski  
Acting Director  
Department of Health and Senior Services

Lead Licensing Program, PO Box 570, Jefferson City, MO 65102